SDMS US EPA Region V

Imagery Insert Form

Document ID:

174090

Some images in this document may be illegible or unavailable in SDMS. Please see reason(s) indicated below:

Specify Type of Document(s) / Comments: Confidential Business Information (CBI). This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format.	IncludesCOLOR or RESOLUTION variations. Unless otherwise noted, these pages are available in monochrome. The source document page(s) is more legible that images. The original document is available for viewing at the Superfund Records Center. Specify Type of Document(s) / Comments: Confidential Business Information (CBI). This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.		Specify Type of Document(s) / Comments:
Unless otherwise noted, these pages are available in monochrome. The source document page(s) is more legible that images. The original document is available for viewing at the Superfund Records Center. Specify Type of Document(s) / Comments: Confidential Business Information (CBI). This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The original document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.	Unless otherwise noted, these pages are available in monochrome. The source document page(s) is more legible that images. The original document is available for viewing at the Superfund Records Center. Specify Type of Document(s) / Comments: Confidential Business Information (CBI). This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The original document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.		SOME DARKENED SQUARES IN TABLE 3-2
Confidential Business Information (CBI). This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The original document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.	Confidential Business Information (CBI). This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The original document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.		Unless otherwise noted, these pages are available in monochrome. The source document page(s) is more legible than
This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments:	This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments:		Specify Type of Document(s) / Comments:
This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments:	This document contains highly sensitive information. Due to confidentiality, materials with such information are no in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document. Specify Type of Document(s) / Comments: Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments:		
Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.	Unscannable Material: Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Document is available at the Records Center.		This document contains highly sensitive information. Due to confidentiality, materials with such information are not
Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origi document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments:	Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The original document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments:		Specify Type of Document(s) / Comments:
Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Occument is available at the Records Center.	Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The original document is available for viewing at the Superfund Records center. Specify Type of Document(s) / Comments: Occument is available at the Records Center.		
			Oversized or Format. Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS. The origin document is available for viewing at the Superfund Records center.
Specify Type of Document(s) / Comments:	Specify Type of Document(s) / Comments:	D	Occument is available at the Records Center.
			Specify Type of Document(s) / Comments:

Five-Year Review Report

Second Five-Year Review Report

For

New Lyme Landfill Town of New Lyme Ashtabula County, Ohio

March 2003

PREPARED BY:

Ohio Environmental Protection Agency Northeast District Office Twinsburg, Ohio 44087

Approved by:

Date:

William E. Muno

Superfund Division Director

U.S. EPA, Region 5

Table of Contents

List c	of Acronyms	iv
Exec	utive Summary	٧
Five-	Year Review Summary Form	vi
I.	Introduction	1
11.	Site Chronology	2
III.	Background Physical Characteristics Land and Resource Use History of Contamination Initial Response Basis for Taking Action	3 4 4
IV.	Remedial Actions Remedy Selection Remedy Implementation System Operations/Operation and Maintenance (O&M) Monitoring Well System	6 6 7
V.	Progress Since the Last Five-Year Review	
VI.	Five-Year Review Process 1 Administrative Components 1 Community Involvement 1 Document Review 1 Data Review 1 Site Inspection 1 Interviews 1	0 1 1 1 3
VII.	Technical Assessment	
	Question B: Are the exposure assumptions, toxicity data, cleanup levels, and remedial action objectives (RAOs) used at the time of the remedy still valid? 1 Question C:	4

	•	ss of the rer	nedy? immary				
VIII. 15	Issues						
IX.	Recommend	itions and Fo	ollow-up Act	ions			 16
X.	Protectivenes	s Statement	(s)				 16
XI.	Next Review						 17
Figure	es						
	Figure 1 Figure 2-1 Figure 2-2 Figure 3-1 Figure 3-2 Figure 3-3	Long Term N Schematic H Shallow Gro Intermediate	n Map Monitoring W Hydrogeolog Jundwater Po Groundwater Hotel	Vell Locati ic Cross S otentiome ter Potenti	ons Section tric Surfac ometric S	ce (Aug - : urface (A	 19 20 21 22
Table	s						
	Table 1 Table 2 Table 3-1 Table 3-2 Table 4 Table 5	Monitoring V Well Depth a Summary of Issues	Vells and Sa Vell Analyse and Ground f Water Qua dations and	es water Elev lity Data .	vation Dat	a	 . 25 . 26 . 31 . 15
Attacl	hments						
	Attachment Attachment 6	List c	nspection S of ARARs Five-Year R			ires	

List of Acronyms

ARAR Applicable or Relevant and Appropriate Requirement

CD Consent Decree

CERCLA Comprehensive Environmental Response, Compensation, and Liability

Α¢

CFR Code of Regulations

DNAPL Dense Non-Aqueous Phase Liquid

EPA Environmental Protection Agency

ESD Explanation of Significant Difference

MCL Maximum Contaminant Level

MCLG Maximum Contaminant Level Goal

NCP National Contingency Plan

NPL National Priorities List

O&M Operation and Maintenance

PAH Polyaromatic Hydrocarbon

PCB Polychlorinated Biphenyl

PRP Potentially Responsible Party

RA Remedial Action

RAO Remedial Action Objective

RD Remedial Design

RI/FS Remedial Investigation/Feasibility Study

ROD Record of Decision

SVOC Semi-Volatile Organic Compound

SDWA Safe Drinking Water Act

USACE United States Army Corp of Engineers

VOC Volatile Organic Compound

Executive Summary

The remedy for the New Lyme Landfill Site in New Lyme, Ashtabula County, Ohio, included the installation of a multi-layer protective cap, a ground water extraction system, a ground water treatment system, and ground water monitoring. After the issuance of an amended Record of Decision (ROD), the remedy for the Site included the discontinuance of the ground water extraction system and the treatment system, and long term ground water monitoring with a generic contingency plan. The trigger for this five-year review was the completion date of the first five-year review on February 24, 1998.

The assessment of this five-year review found that the remedy was constructed in accordance with the requirements of the ROD and the amended ROD. The remedy is functioning as designed. The immediate threats have been addressed and the remedy is expected to be protective when ground water cleanup goals are achieved.

Five-Year Review Summary Form

SITE IDENTIFICATION						
Site Name : New I	_yme Land	fill				
U.S. EPA ID: OH	098079461	4				1
OHIO EPA ID: 204	I-0559					
Region: 5	State: Of	nio	City/Cou	ınty: N	lew Lyme	/Ashtabula
		SIT	E STATUS	6		
DNPL Status: X	Final	Deleted	Other	(specif	fy)	
Remediation Statu	ıs: (choos	e all that		Undo		uctionOperating
Multiple OUs?* _	Yes _ <u>_X</u>	_ No	Constru 12/29/19		Completic	on Date:
Has site been put	into reuse	?Y	′es <u>X</u> N	0		
		REVI	EW STAT	US		
Lead Agency: X	U.S. EPA	Sta	ateT	ribe _	Other	Federal Agency
Author Name: And	drew C. Ko	cher	-			
Author Title: Site Coordinator		Author Office	Affiliation	ı: Ohio	EPA / No	ortheast District
Review Period:**	6/5/2002 to	2/24/03				
Date(s) of Site Ins	pection: 1	0/24/02 &	11/14/02			
Type of Review: Post-SARA _X Pre-SARA NPL-Removal Only Non-NPL Remedial Action Site NPL State/Tribe-lead Regional Discretion						
Review Number:	1 (first)	<u>X</u> 2	(second)	3 ((third)	_ Other (specify)
Triggering Action: Actual RA On-Site Construction OU # Actual RA Start at OU # Construction Completion _X Previous Five-Year Review Report Other						
Triggering Action	Date: 2/24	4/1998	·			
Due Date (five years after triggering action date): 2/24/2003						

^{* [&}quot;OU" refers to operable unit.]

** [Review period should correspond to the actual start and end dates of the Five-Year Review in WasteLAN.]

Five-Year Review Summary Form - cont.

Issues:

Numerous areas where subsidence has occurred (low spots), located on the eastern portion of the landfill.

Inadequate monitoring data to verify that the plume is not migrating within the deep aquifer (lower zone of the bedrock aquifer).

Lack of analytical projections to predict length of time until ground water cleanup goals will be achieved.

High arsenic levels at the Site.

Recommendations and Follow-up Actions:

Develop plan to repair "low spots," submit plan to U.S. EPA for approval, conduct repair activities.

Conduct periodic sampling of the following wells: MW-6C, MW-9C, MW-15C, MW-17C, MW-18C. The sampling frequency and analyses may be modified as appropriate in 2003.

Conduct analytical projections to determine length of time until ground water cleanup goals will be achieved.

Further investigate high arsenic levels, including potential from natural occurrences.

Protectiveness Statement:

All immediate threats at the site have been addressed, and the remedy is expected to be protective of human health and the environment.

Long-term Protectiveness:

Current monitoring data indicate that the plume remains onsite and that the remedy is functioning as required to achieve ground water cleanup goals. Continuing ground water sampling will insure that contaminants will remain on the site.

Other Comments:

All current monitoring data indicate that the plume remains onsite. Therefore, monitoring frequency shall be reevaluated following the final report summarizing all eight quarters of sampling data.

New Lyme Landfill Site New Lyme, Ashtabula County, Ohio Second Five-Year Review Report

I. Introduction

The Ohio Environmental Protection Agency (Ohio EPA) has conducted a Five-Year Review for the United States Environmental Protection Agency (U.S. EPA) at the New Lyme Landfill site (the Site), Ashtabula, Ohio. The purpose of the Five-Year Review is to ensure that the remedial action implemented at the New Lyme Landfill site remains protective of public health and the environment. The methods, findings, and conclusions of reviews are documented in Five-Year Review reports. In addition, Five-Year Review reports identify issues found during the review, if any, and identify recommendations to address them.

Ohio EPA is preparing this Five-Year Review report pursuant to CERCLA § 121 and the National Contingency Plan (NCP). CERCLA § 121 states:

If the President selects a remedial action that results in any hazardous substances, pollutants, or contaminants remaining at the site, the President shall review such remedial action no less often than each five years after the initiation of such remedial action to assure that human health and the environment are being protected by the remedial action being implemented. In addition, if upon such review it is the judgement of the President that action is appropriate at such site in accordance with Section [104] or [106], the President shall take or require such action. The President shall report to the Congress a list of facilities for which such review is required, the results of all such reviews, and any actions taken as a result of such reviews.

The U.S. EPA interpreted this requirement further in the NCP; 40 C.F.R. § 300.430(f)(4)(ii) states:

If a remedial action is selected that results in hazardous substances, pollutants, or contaminants remaining at the site above levels that allow for unlimited use and unrestricted exposure, the lead agency shall review such action no less often than every five years after the initiation of the selected remedial action.

Ohio EPA conducted the Five-Year Review of the remedy implemented at the New Lyme Site (Site) in New Lyme, Ashtabula County, Ohio. This review was conducted by Ohio EPA's Site Coordinator and reviewed by the U.S. EPA Remedial Project Manager (RPM) for the entire Site from June 2002 through February 2003. This report documents the results of the review.

This is the second five-year review for the New Lyme Site. The triggering action for this policy review is the signature date of the first Five-Year Review on February 24, 1998. The Site is pre-SARA and the first Five-Year Review was conducted as a matter of policy. Due to the fact that a ROD Amendment was issue in 1999 for the Site, the five-year review is now required by the Statue since hazardous substances, pollutants, or contaminants remain at the Site above levels that allow for unlimited use and unrestricted exposure.

II. Site Chronology

Table 1 - Chronology of Site Events

Event	Date
Landfill received household, industrial, commercial, and institutional wastes,	1969 - 1978
as well as construction and demolition debris.	
Facility obtained license to operate.	1971
Numerous violations occurred.	1971 - 1978
Landfill closed by Ashtabula County Health Department.	8/1978
Site discovery.	5/1/1982
Site inspection.	7/1/1982
Proposal to NPL.	12/30/1982
Preliminary assessment completed.	1/1/1983
Remedial Investigation (RI) was conducted.	8/1983 - 8/1984
Final listing on NPL.	9/8/1983
Remedial Investigation Report completed.	2/1985
Feasibility Study Report completed.	9/1985
ROD/Remedial Alternative Selection signed.	9/1985
Extraction wells were installed.	1989
Pumping and water treatment begins.	10/3/1990
Construction completion.	12/29/1992
	1/13/1994 -
Removal activities conducted at the Site.	1/18/1994
State of Ohio assumes the O&M responsibilities at the Site.	7/24/1994
Potentially Responsible Parties (PRP) assumes the O&M	1997
responsibilities a the Site.	
First Five-Year Review signed.	2/24/1998
Focused Feasibility Study completed.	1998
ROD Amendment signed.	11/16/1999
Deactivation of the ground water extraction/treatment system.	7/27/2001
Long-term groundwater monitoring begins.	8/2001
5 th Quarter Sampling Event	9/2002 - 10/2002

III. Background

Physical Characteristics

The New Lyme Landfill Site property is about one mile west of State Route 11 on Dodgeville Road in Ashtabula County, approximately midway between the cities of Warren and Ashtabula. The Site is about three miles east of Dodgeville and about one mile west of the intersection of Dodgeville and Hunter Roads (Figure 1). The landfill is irregular in shape and occupies about 40 acres of the approximately 100-acre tract. On the north, it is bounded by Dodgeville Road and a wooded wetland area associated with Lebanon Creek. Wooded wetland areas also form the west and south boundaries; directly west of the Site is a lake. The land to the west is a wildlife area used for public hunting and fishing. East of the Site, land has been cleared for agricultural use.

A regional water shed divide between the Lebanon Creek and Mosquito watersheds lies approximately one-quarter mile south of the Site. Surface water drainage from the landfill and the immediately surrounding area discharges to Lebanon Creek. During the RI phase there did not appear to be any discharges from the Site to the Mosquito Creek watershed. Discharges from the Site are carried by Lebanon Creek to Rock Creek, and by Rock Creek to the Lake Roaming Rock Reservoir. The reservoir is approximately five miles downstream of the Site. Several marshy areas surround the landfill on the north, west and south sides. The ground surface of the landfill is nearly level and is approximately five to six feet above the surrounding grade. The Site is in a wooded, marshy area, which straddles the divide between the Great Lakes and Mississippi River drainage basins.

Land and Resource Use

The New Lyme Landfill began operations in 1969. The landfill received household, industrial, commercial and institutional wastes, as well as construction and demolition debris between 1969 and 1978. Initially managed by two area farmers, the landfill was licensed by the State of Ohio in 1971 and operations were taken over by a licensed landfill operator. There were numerous violations of the license, the Ohio Revised Code, and the Ohio Administrative Code. In early August 1978, the landfill was closed by the Ashtabula County Health Department, because of numerous violations, including open dumping, improper spreading and compacting of waste; no state approval for disposal of certain industrial wastes; and reported excavation of trenches into the shale bedrock.

The area west of the landfill is operated by the Ohio Department of Natural Resources, Division of Wildlife, as a public hunting and fishing area. Within the

wildlife area, an approximately 54-acre lake was installed and the clay excavated was used as a cap for the landfill in 1990.

History of Contamination

According to Ohio EPA documentation, an average 5,500 cubic yards of domestic wastes, 8,000 cubic yards of commercial wastes, and 14,000 cubic yards of industrial wastes per month were disposed of at the landfill. Documents indicated that wastes at the New Lyme Site included: coal tar and coal tar distillates; asbestos; resins and resin tar; paint and paint sludge; miscellaneous oils; lacquer thinner; peroxide; various corrosive liquids; acetone; xylene; toluene; kerosene; naphtha; benzene; trichloroethene (TCE); linseed oil; mineral oil; fuel oil; miscellaneous chlorinated solvents; 2,4-D; laboratory chemicals; and waste waters.

Initial Response

After receiving numerous violations, the U.S. EPA conducted a Site inspection to determine eligibility for the National Priorities List (NPL). The Site was proposed for the NPL on December 31, 1982. Subsequent remedial investigations and activities were funded by the U.S. EPA until 1997 when the PRPs began to manage the Site. A remedial investigation (RI) was conducted on behalf of U.S. EPA by CH2M Hill from August 1983 to August 1984. Remedial investigation activities included magnetometer surveys and collection of on-Site samples for chemical analysis of surface and subsurface soil, Lebanon Creek, sediment and water, ground water, and leachate seeps.

Basis for Taking Action

Contaminants:

Soil

Hazardous substances that have been released at the Site in each media include:

Leachate

<u>5011</u>	Leachate
PCB's	PAHs
Mercury	Phthalates
PAHs	P-Chloro-M-Cresol
Phthalates	Pentachlorophenol
Dibenzofuran	Phenol
Ethylbenzene	Benzoic Acid
Toluene	2-Methylphenol
2-Butanone (MEK)	1,4-Dichlorobenzene
2-Hexanone	N-Nitrosodiphenylamine
4-Methyl-2-Pentanone	Benzyl Alcohol

Soil Leachate **Xylene** Acrolein Fluorotrichloromethane 1.2-Dichloroethane Tetrachloroethene 1,1-Dichloroethane Trans-1,3-Dichloropropene Styrene 1,1,1-Trichloroethene Ethylbenzene Carbon Disulfide Chloromethane Methylene Chloride **Ground Water** Toluene Trichloroethene 1.2-Dichloroethane Vinyl Chloride Methylene Chloride 2-Butanone (MEK) 2-Butanone (MEK) 2-Hexanone

Surface Water

Ethylbenzene

4-Methyl-2-Pentanone

2-Hexanone

Sediment (at Leachate Sites)

Trichloroethene Tetrachloroethene Acetone

Ethylbenzene Methylene Chloride

4-Methyl-2-Pentanone

Toluene

Xylene

Acetone

2-Butanone (MEK) 4-Methyl-2-Pentanone

Xylene Acetone

Trans-1,2-Dichloroethene

IV Remedial Actions

Remedy Selection

On September 27, 1985, U.S. EPA signed a ROD for the New Lyme Landfill Site. Consistent with the Comprehensive Environmental Response, Compensation and Liability Act of 1980 (CERCLA), and the National Contingency Plan (40 CFR Part 300), U.S. EPA determined that taking source control action by capping the landfill and consolidating contaminated sediment under the cap, and taking management of migration action by extraction and on Site treatment of contaminated leachate and ground water at the New Lyme Site was a cost-effective remedy that provides adequate protection of public health, welfare and the environment. The State of Ohio was consulted and agreed with the approved remedy. In addition, the action did require further operation and maintenance activities, to ensure the continued effectiveness of the remedy. It was also determined that the action taken was

appropriate when balanced against the availability of Trust Fund monies for use at other Sites. Through a consent decree, the PRPs assumed O&M responsibilities for the Site. The consent decree was lodged on August 16, 2000 and entered on November 9, 2000.

Specifically, the components of the selected remedy included:

- Installation of RCRA cap over the landfill with gas vents.
- Installation of extraction/containment wells around the Site perimeter to dewater landfill and eliminate leachate production.
- OnSite consolidation of contaminated sediment under the cap.
- Treatment of extracted ground water using pH adjustment, biodisc, metals removal by NaOH precipitation, and granular activated carbon finishing until the treatment system becomes unnecessary (after about 15 years).
- Installation of a ground water monitoring system around the Site perimeter.
- Erection of a perimeter fence around the Site.

Remedy Implementation

A Remedial Investigation (RI) was conducted from August 1983 to August 1984 by CH2M Hill for U.S. EPA's Remedial Planning/Field Investigation Team. Based primarily on information obtained during this investigation, Donahue & Associates, Inc. (Donahue) modeled the ground water flow at the Site using a two-dimensional, nonsteady-state ground water flow model called PLASMER 4, which is a modified version of the Prickett-Lonnquist Aquifer Simulation Model known as PLASM (Prickett 1971). As described on GW-11 of the 1987 Design Analysis, this model can simulate flow in a confined/unconfined, homogenous/heterogeneous, isotropic/anisotropic aquifer system.

Based on the modeling results, Donahue designed a dewatering and treatment system that included 13 extraction wells and 18 clusters of monitoring wells (Figure 2). The extraction well network was designed to lower the water table to a depth of at least 20 feet throughout the Site within six years of initiation of pumping. Installation of the wells was completed in mid-1989, and pumping and water treatment began in late 1990.

As stated in the 1986 Predesign Report (pages 2-4), the extraction system installed at New Lyme Landfill in the late 1980's was intended to:

- lower the water table to a level 20 feet below ground surface;
- control ground water flux into the Site;
- control off-Site migration of contaminants dissolved in ground water;
- stabilize the residual contaminants (in the soil);
- extract contaminants dissolved on ground water.

System Operation/Operation and Maintenance

The RA construction contract was awarded to Sevenson Environmental Services (SES) in September 1988, with Site construction activities commencing in December 1988. Part of the RA activities included the construction of a unit process Waste Water Treatment Plant (WWTP), as well as a ground water extraction system installed that consisted of 13 extraction wells located around the perimeter of the landfill area. Construction of a leachate collection system began in September 1989 and was completed in December 1989. The system was originally designed as a french drain, which discharged into manholes around the Site perimeter. On an as need basis, these manholes would manually be pumped and the leachate transferred to the WWTP for treatment. This leachate collection system was modified in June 1993, to allow for the leachate to be pumped mechanically directly to the WWTP, therefore, eliminating the need for manual pumping and the potential for spills.

Ohio EPA assumed O&M from the U.S. EPA for the WWTP on July 1994, while U.S. EPA maintained responsibility for the extraction system and the associated O&M program. In August 1994, a section of the black iron piping in extraction well # 5 connecting the stainless steel extraction well to the high density polyethylene (HDPE) main header feed system, to the WWTP ruptured, causing a complete shutdown of the treatment plant and extraction system. Following several months of negotiations with U.S. EPA concerning this issue, Ohio EPA, in the best interest of human health and the environment, pursued and obtained state funding for the project. To eliminate the potential for rupture of other extraction well piping. Ohio EPA decided to replace all the black iron piping with stainless steel in the remaining extraction wells. Additionally, each extraction well was fitted with a valve, capable of isolating each individual well from the header system. These isolation devices eliminate the need to shut down the system in the future, should additional work need to be completed on individual wells in the system. The repairs began in December 1994 and were completed in February 1995. The extraction system and the WWTP went back on-line in March 1995 and have been operational since.

In May 1996, Ohio EPA, following review and discussions of WWTP influent and effluent data, discontinued use of several treatment unit processes, which included the metals precipitation process including pH adjustment and the rotating biological contractors (RBC's) and their related nutrient feed system. There were no indications from influent analytical data that any significant metals or organics were part of the influent groundwater to the WWTP. Therefore, unit processes designed to deal with these contaminates were no longer needed. The nutrient feed system for the RBC units was actually degrading the water quality by adding such metals as zinc to the effluent stream. Currently, the WWTP operational units include a tertiary sand filter treatment and two 10,000 gallon units prior to discharge to Lebanon Creek. From the effluent analytical data, there appears to be no discharges that have been above those established to be protective of human health and the environment. The discharge limits have been orders of magnitude lower than are required to meet the current discharge limits. There appears to be no problems with the treatment train modification to date, and the plant continues to treat influent groundwater as it was designed.

Data collected during the Operational and Maintenance (O&M) at the New Lyme Landfill suggest an absence of expected change in the level of contaminants. The concentration of contaminants in the extracted ground water from the pump and treat system is lower than what was expected in the ROD. Since completion of the Remedial Action (RA) and installation of the low permeable landfill cover, there appears to be a decrease in the potentiometric surface level of the ground water in the monitoring wells and by the absence of leachate seeps, suggesting a reduction in surface water infiltration into the landfill. With the pump and treat system operational, some wells did equilibrate with artesian conditions.

V. Progress Since the Last Five-Year Review

On February 24, 1998, the First Five-Year Review was completed. A level II review was chosen based upon the above information. Additional data was collected to support recommendations in the review. With the absence of leachate seeps from the existing remedy and the other pathways continue to remain unchanged, there does not appear to be any additional risk pathways to recalculate. Therefore, recalculation of risk was not warranted at the time. Overall, the eight general recommendations from the first review were:

- Implement the new discharge limits reflective of Ohio Water Quality Limits and the Great Lakes Initiative October 31, 1997.
- Sample residential wells on an annual basis.
- Re-evaluate and define rate and extent of off-Site ground water contamination.

- Install one downgradient monitoring well cluster (3 wells) immediately to the
 west offSite and two side gradient monitoring well clusters (3 wells each)
 offSite.
- Replace the damaged monitoring well MW-20A.
- Evaluate and install additional bedrock monitoring wells to adequately monitor the entire Site and verify bedrock flow direction.
- Re-evaluate Sampling and Analysis Plan and QA/QC, concerning detection limits.
- Continue maintenance of the cap, gas system, fence, WWTP, etc.

In addition to the Five-Year Review Report, the PRPs performed ground water investigations and issued a Hydrogeological Report in December 1996, and a subsequent Remedial Alternatives Report in January 1997. U.S. EPA and Ohio EPA also conducted a Focused Feasibility Study for the Site in September 1998. These reports and the First Five-Year Review showed that the original remedial action lowered the water table but did not de-watered the landfill. On November 16, 1999, a ROD Amendment was signed.

ROD Amendment

The ROD Amendment was written due to changes in Site conditions. The amended Site Plan included the following components:

- 1. Shutdown of the on-Site ground water treatment plant.
- 2. Implementation of an amended long-term ground water monitoring program.
- 3. Site specific triggers that may initiate contingency plans.
- 4. Continued operation and maintenance of the installed cap, including leachate control if necessary, and continued Site security.

These changes to the original ROD were implemented due to a re-evaluation of the Site. In March 1998, U.S. EPA and Ohio EPA evaluated how protective the original plan was to human health and the environment. The results of this evaluation are included in the New Lyme Landfill, first Five Year Review Report. Additionally, with few exceptions, the ground water extracted from beneath the landfill showed no signs of contamination above regulatory limits. These changes to ROD were determined by U.S. EPA and Ohio EPA, to provide the same level of protectiveness in a more cost-effective manner.

The amended plan involved the discontinuation of the onSite treatment of ground water and leachate. This was accomplished through the complete shutdown of the extraction system, extraction wells, and the ground water treatment plant on July 27, 2001.

The second component to the ROD amendment included the implementation of a long-term ground water monitoring program. This program included the quarterly sampling of 19 wells, the semi-annual sampling of eight additional monitoring wells, and annual sampling of 6 residential wells. The specific wells to be sampled are listed in Table 1, and the corresponding analytical methods to be performed for these well samples are indicated in Table 2. In additional to the well sampling, the ROD Amendment stated that water-level data will be collected from all wells during each sampling event.

The third component to the ROD Amendment describes the levels of the analytical results, which will trigger a contingency plan. These triggers include all Maximum Contaminant Levels (MCLs) and (if no MCL is listed for a contaminant) a 1 x 10⁻⁵ cumulative risk level. The ROD Amendment states that if these triggers are met or exceeded, than that well will be re-sampled and analyzed for the specific contaminant. If the analysis indicates a repeated excursion, then the contingency plan will be implemented. The contingency plan will be approved by U.S. EPA and Ohio EPA, and will include details on methods to define, among other things, the rate, concentration, and extent of the release. The contingency plan is not defined, because the chosen plan will be Site and incident specific.

The last component of the ROD Amendment controls operation and maintenance of the installed cap (e.g., groundhog holes, landscaping, etc.), leachate control, if necessary, and Site security (e.g., Site inspections, fencing repair, etc.).

VI. Five-Year Review Process

Administration Components

The Five-Year Review team was led by Lolita Hill of the U.S. EPA, Remedial Project Manager (RPM) for the New Lyme Site, and included members from the Regional Technical Advisory staff with expertise in hydrology, biology, and risk assessment. The Site Coordinator, Andrew Kocher, for Ohio EPA, assisted in the report generation as the representative for the support agency. Members of the PRP Group consultants, Brown and Caldwell, Inc., were notified of the Five-Year Review in July 2002.

From July 1 to December 31, 2002, the support agency completed the following activities:

- Community Involvement
- Document Review
- Data Review
- Site Inspection
- Local Interviews
- Five-Year Review Report Development and Review.

From January to February 2003, U.S. EPA and the Ohio EPA reviewed the draft report. The comments were addressed immediately following, and a revised draft report reviewed and the final report signed by the director of the Superfund Division.

Community Involvement

Activities to involve the community in the Five-Year Review process were initiated with a Site visit in October. Ohio EPA conducted home interviews with the surrounding community residents. A letter was given to each homeowner with contact numbers and address. Comments were accepted during the month of November. The letter invited the recipients to submit any comments to Ohio EPA.

During the comment period, local residents expressed concerns that the State Wildlife Area was attracting excess people and traffic. None of the residents expressed any concerns over the protectiveness of the remedy.

Upon signature of this review, the results of the review and the report were available to the public at the New Lyme Town Library and Ohio EPA's Northeast District office.

Document Review

This Five-Year Review consisted of a review of relevant documents including O&M records and monitoring data. A major portion of these documents consisted of the recent quarterly reports beginning during the month of September 2001.

Data Review

Monitoring Well System

A series of 59 monitoring wells currently exist around the perimeter of the landfill area. Of those 59 wells, 51 of them are located on-Site, while the other 8 are

located off-Site, both up-gradient and down-gradient of the Site. Construction and installation of both on-Site and off-Site monitoring wells began in June 1989, and was completed in October 1989. The USACE contracted SES in May 1993, to conduct Site related operations for the abandonment and replacement of all the existing landfill ground water monitoring wells, which were destroyed as a result of landfill subsidence. The abandonment and replacement activities began in November 1993, and were completed in May 1994, resulting in the current 51 on-Site monitoring wells.

The monitoring wells were originally designated to be sampled on a quarterly basis and were until May 1996, when Ohio EPA reduced that frequency to twice a year. The reasoning behind this reduction in sampling frequency was the indication from analytical results that no contaminates of concern were detected above established MCL's.

Ground Water Monitoring

Ground water monitoring has been conducted at the New Lyme Site since the early 1980s. In general, most contaminants were detected at their highest levels early in the investigation (1983 and 1984). This high level followed by a drop in contaminant levels may well have been the result of removal activities eliminating significant source material.

On August 27, 2001, quarterly ground water sampling began under the revised monitoring plan per the amended ROD. The monitoring included the collection of ground water elevations (see Table 3-1) and the collection of a sample for laboratory analysis (see Table 3-2). The first quarterly sampling event was conducted to obtain representative "baseline" conditions and was considered to essentially represent pumping conditions at the Site. Every quarterly sampling event afterwards was conducted to determine if contamination would reappear after shutting down the groundwater treatment plant. In addition to looking for contaminants, samples were analyzed for typical natural attenuation parameters. Some of these additional laboratory parameters include, but are not limited to, chemical oxygen demand, chloride, nitrate, and sulfate. Table 3-2, Summary of Water Quality Data, compares all analytical results for all parameters that exceeded their corresponding reporting limit between quarterly sampling events.

Although monitored natural attenuation is being evaluated, it is very difficult to determine if monitored natural attenuation is actually occurring at the Site. This conclusion can be drawn because no plume is delineated, only perimeter wells are being sampled, and no contaminants are being detected over their corresponding triggers. However, ground water conditions can be evaluated assuming potential contaminants and their likelihood to be degraded in the current underground environment. Therefore, a determination can be made whether monitored natural attenuation would be occurring outside the landfill if contamination was detected.

To date, a detailed evaluation of the monitored natural attenuation parameters, underground environment, and likelihood of degradation has not been performed.

There is some concern that the local ground water has not recovered to ambient conditions following the shut down of the treatment plant. In general, shallow ground water flow direction at the Site continues to be to the west; however, the potentiometric map (Figure 3-1) shows a slight southernly flow at the south western portion of the landfill. Figure 3-2 shows the potentiometric surface of the intermediate aquifer. This aquifer has a flow direction toward the west. The deep aquifer shows a northern flow direction, as represented in the potentiometric surface map in Figure 3-3. Ground water levels will continue to be monitored throughout the remaining three-quarters of sampling, in order to gather additional evidence to show whether ambient conditions have been reached.

Another concern is the lack of analytical data from the deep aquifer. These monitoring wells are generally completed to a depth of 90 feet and monitor the lower zone of the bedrock aquifer. It is recommended that these wells (MW-6C, MW-9C, MW-15C, MW-17C, and MW-18C) be monitored to determine if any contaminants are penetrating vertically through the unconsolidated glacial material and the bedrock. The concern bears upon the following facts:

- The nearest residential well is within 750 feet of the Site.
- The nearest residential well is located to the north, the direction of the deep aquifer flow.
- Some of the residential wells extract ground water from the deep aquifer zone.
- The landfill contains DNAPLs, which tend to migrate vertically prior to migrating horizontally, potentially traveling underneath the intermediate monitoring wells.

Private Drinking Water Monitoring

Drinking water well monitoring has been conducted annually since August/September, 2001. Table 1 shows the name and addresses of the residential wells sampled and Table 2 shows the analytical methods conducted on the samples collected. Both sampling events found that all contaminants of concern were below detection limits. A few metals (iron, manganese, and sodium) were detected at levels below their respective secondary drinking water standards (see Table 3-2).

To date, a detailed evaluation of the monitored natural attenuation parameters, underground environment, and likelihood of degradation has not been performed.

There is some concern that the local ground water has not recovered to ambient conditions following the shut down of the treatment plant. In general, shallow ground water flow direction at the Site continues to be to the west; however, the potentiometric map (Figure 3-1) shows a slight southernly flow at the south western portion of the landfill. Figure 3-2 shows the potentiometric surface of the intermediate aquifer. This aquifer has a flow direction toward the west. The deep aquifer shows a northern flow direction, as represented in the potentiometric surface map in Figure 3-3. Ground water levels will continue to be monitored throughout the remaining three-quarters of sampling, in order to gather additional evidence to show whether ambient conditions have been reached.

Another concern is the lack of analytical data from the deep aquifer. These monitoring wells are generally completed to a depth of 90 feet and monitor the lower zone of the bedrock aquifer. It is recommended that these wells (MW-6C, MW-9C, MW-15C, MW-17C, and MW-18C) be monitored to determine if any contaminants are penetrating vertically through the unconsolidated glacial material and the bedrock. The concern bears upon the following facts:

- The nearest residential well is within 750 feet of the Site.
- The nearest residential well is located to the north, the direction of the deep aquifer flow.
- Some of the residential wells extract ground water from the deep aquifer zone.
- The landfill contains DNAPLs, which tend to migrate vertically prior to migrating horizontally, potentially traveling underneath the intermediate monitoring wells.

Private Drinking Water Monitoring

Drinking water well monitoring has been conducted annually since August/September, 2001. Table 1 shows the name and addresses of the residential wells sampled and Table 2 shows the analytical methods conducted on the samples collected. Both sampling events found that all contaminants of concern were below detection limits. A few metals (iron, manganese, and sodium) were detected at levels below their respective secondary drinking water standards (see Table 3-2).

Site Inspection

Inspections at the Site were conducted on October 24th, and November 14, 2002, by the Ohio EPA Site Coordinator and Brown and Caldwell Environmental Engineering & Consulting, the PRPs representatives (See Attachment A). The purpose of the inspections was to assess the protectiveness of the remedy, including the presence of fencing to restrict access, the integrity of the cap, and the condition of the gas venting system. The resulting lake built nearby to supply the clay for the landfill cap was also visually inspected.

No significant issues have been identified at any time regarding the cap, the drainage structures, or the fence. Examination of the cap revealed that there had been some subsidence in various locations, some of these locations contained standing water. All of these "low spots" were located on the eastern portion of the cap.

A few other minor issues were observed during the Site inspection included corroded locks and missing fence clips at a few locations along the perimeter fence. Also, there was a lack of perimeter "No Trespassing" signs to deter unauthorized access to the landfill and former treatment plant. Although these issues were noted during this review, they do not affect the protectiveness of the remedy. These minor issues were brought to the PRP's attention and locks, fence clips, and signs were replaced prior to the completion of this review.

Interviews

Interviews were conducted with various parties connected to the Site. Ray and Vera Kaderly, owner of nearby residential property, were interviewed on October 24, 2002. Three other nearby residents, Sherry Monroe, John Mezinger, and Genevieve Draid, were supplied with interview questionnaires, and responded on October 28, 2002 (See Attachment A). No significant problems regarding the Site were identified during the interviews. However, Mr. Mezinger did note that traffic has increased due to the public access to Public Hunting and Fishing Area.

VII. Technical Assessment

Question A: Is the remedy functioning as intended by the decision documents?

The review of documents, Applicable or Relevant and Appropriate Requirements (ARARs), risk assumptions, and the results of the Site Inspection (SI), indicates that the remedy is functioning as intended by the ROD, and as modified by the ROD Amendment. The stabilization and capping of contaminated soils and sediments has achieved the remedial objectives to minimize the migration of contaminants to ground water and surface water, and prevent direct contact with, or ingestion of,

contaminants in soil and sediments. The effective implementation of institutional controls has prevented exposure to, or ingestion of, contaminated ground water.

Operation and maintenance of the cap and drainage structures has, on the whole, been effective. A few small areas showed evidence of "low spots." The low spots did not penetrate beyond the cap, and, so, did not affect protectiveness. However, the PRP's have agreed to properly repair these areas. O&M annual costs have decreased below original estimates and there are no indications of any difficulties with the remedy.

The institutional controls that are in place include prohibitions on the use or disturbance of groundwater, excavation activities, disturbance of the cap, and any other activities or actions that might interfere with the implemented remedy. No activities were observed that would have violated the institutional controls. The cap and the surrounding area were undisturbed, and no new uses of ground water were observed at the Site. However, the PRP has agreed to properly repair the "low spots" in the cap, which may temporarily affect the institutional control in the near future.

Question B: Are the exposure assumptions, toxicity data, cleanup levels, and remedial action objectives (RAOs) used at the time of the remedy selection still valid?

There have been no changes in the physical conditions of the Site that would affect the protectiveness of the remedy.

Changes in Standards and To Be Considered

As the remedial work has been completed, most ARARs for soil contamination cited in the ROD have been met. ARARs that still must be met, at this time, and that have been evaluated include: the Safe Drinking Water Act (SDWA) (40 CFR 141.11-141.16) from which many of the groundwater cleanup levels were derived - [Maximum Contaminant Levels (MCLs), and MCL Goals]; and ARARs related to post-closure monitoring. A revised and updated list of ARARs is included in Attachment B.

There is one new standard that will affect the protectiveness of the remedy. The MCL for arsenic has been decreased from 50 ug/L to 10 ug/L. This change in the MCL is more protective for human health when concerning direct human consumption via a public water supply system. This new MCL will become effective beginning on January 23, 2006. Therefore, this change will be implemented at the Site before the next Five-Year Review. Additionally, numerous metals, including arsenic, have been detected in up-gradient and side-gradient wells. Initially, it was considered to implement a change in the ROD Amendment to eliminate the resampling of up-gradient wells. However, due to the concern that the local ground

water has not recovered to ambient conditions, the up-gradient wells will be treated the same as the rest of the wells, as specified in the ROD Amendment. Ohio EPA does recommend that this issue be re-evaluated following completion of the eight quarters of sampling and final report.

Changes in Exposure Pathways, Toxicity, and Other Contaminant Characteristics

The exposure assumptions used to develop the Human Health Risk Assessment included both current exposures (older child trespasser, adult trespasser) and potential future exposures (young and older future child resident, future adult resident and future adult worker). There have been no changes in the toxicity factors for the contaminants of concern that were used in the baseline risk assessment. These assumptions are considered to be conservative and reasonable in evaluating risk and developing risk-based cleanup levels. No change to these assumptions, or the cleanup levels developed from them is warranted. There has been no change to the standardized risk assessment methodology that could affect the protectiveness of the remedy. The remedy is progressing as expected, and it is expected that all ground water monitoring levels will remain within the ROD Amendment's prescribed limits.

Question C: Has any other information come to light that could call into question the protectiveness of the remedy?

Analytical results from the ground water monitoring have not indicated a concern of the protectiveness of the remedy. Ecological targets were not identified during the baseline risk assessment and none were identified during the first Five-Year Review and, therefore, monitoring of ecological targets is not necessary. No weather-related events have affected the protectiveness of the remedy. There is no other information that calls into question the protectiveness of the remedy.

Technical Assessment Summary

According to the data reviewed, the SI, and the interviews, the remedy is functioning as intended by the ROD and as modified by the ROD Amendment. There have been no changes in the physical conditions of the Site that would affect the protectiveness of the remedy. Most ARARs for soil contamination cited in the ROD have been met. There has been no changes in the toxicity factors for the contaminants of concern that were used in the baseline risk assessment, and there have been no changes to the standardized risk assessment methodology that could affect the protectiveness of the remedy. There is no other information that calls into question the protectiveness of the remedy.

VIII. Issues

Table 4 - Issue

Issue	Currently Affects Protectiveness	Affects Future Protectiveness
	(Y/N)	(Y/N)
Evidence of corroded locks and		
missing fence clips at a few	N	N
locations along the perimeter		
fencing.		
Lack of perimeter "No Trespassing"		
signs to deter unauthorized access		
to the landfill and former treatment	N	N
plant.		
Numerous areas where subsidence		
has occurred (low spots) located on	N	Υ
the eastern portion of the landfill.		
Inadequate monitoring data to verify		
that the plume is not migrating		
within the deep aquifer (lower zone	N	Y
of the bedrock aquifer).		
Lack of analytical projections to		
predict length of time until ground	N	N
water cleanup goals will be		
achieved.		
High arsenic levels at the Site.	N	N

IX. Recommendations and Follow-Up Actions

Table 5 - Recommendations and Follow-Up Actions

Issue	Recommendations/	Party	Oversight	Milestone	l	ects veness?
	Follow-up Actions	Responsible	Agency	Date	(Y.	/N)
					Current	Future
Subsidence of	Develop plan to repair					
cap	"low spots".					
	 Submit plan to EPA for approval. 					:
	Conduct repair activities.	PRPs	State/EPA	6/30/2003	N	Y
Inadequate	Conduct periodic sampling of					
monitoring	the following wells: MW-6C,					
within the deep	MW-9C, MW-15C, MW-17C,					
aquifer	MW-18C. The sampling					
	frequency and analyses will			·		
	be determined following a					
	ESD or ROD Amendment in					
1	2003.	PRPs	State/EPA	12/30/03	N	Y
Lack of	Conduct analytical projections,					
analytical	determine length of time until					
projections	ground water cleanup goals					
ļ	will be achieved.	PRPs	State/EPA	12/30/03	N	N
High arsenic	Further investigate high					
levels	arsenic levels. Determine					
	new trigger level before new					
	MCL is in effect.	PRPs	State/EPA	12/30/03	N	N


IX. Protectiveness Statement


The remedy is expected to continue to be protective of human health and the environment. This natural attenuation process will be continuously monitored and evaluated to project when the cleanup goals will be achieved. In the interim, exposure pathways that could result in unacceptable risks are being controlled and institutional controls are preventing exposure to, or the ingestion of, contaminated ground water. All threats at the Site have been addressed through stabilization and capping of contaminated soil, sediments, and ash, the installation of fencing and warning signs, and the implementation of institutional controls.

Long-term protectiveness of the remedial action will be verified by obtaining additional ground water samples to fully evaluate potential migration of the contaminant plume downgradient from the landfill area. Current data indicate that the plume remains on Site. Additional sampling and analysis will be completed within the next six months. Current monitoring data indicate that the remedy is functioning as required.

XI. Next Review

The next Five-Year Review for the New Lyme Landfill Site is required 5 years from the signature of this report (February 2008).

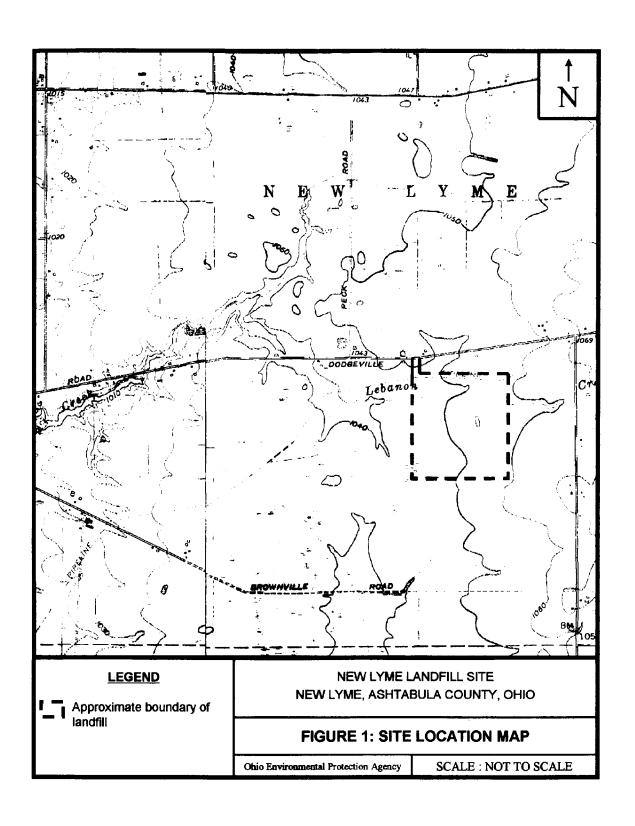

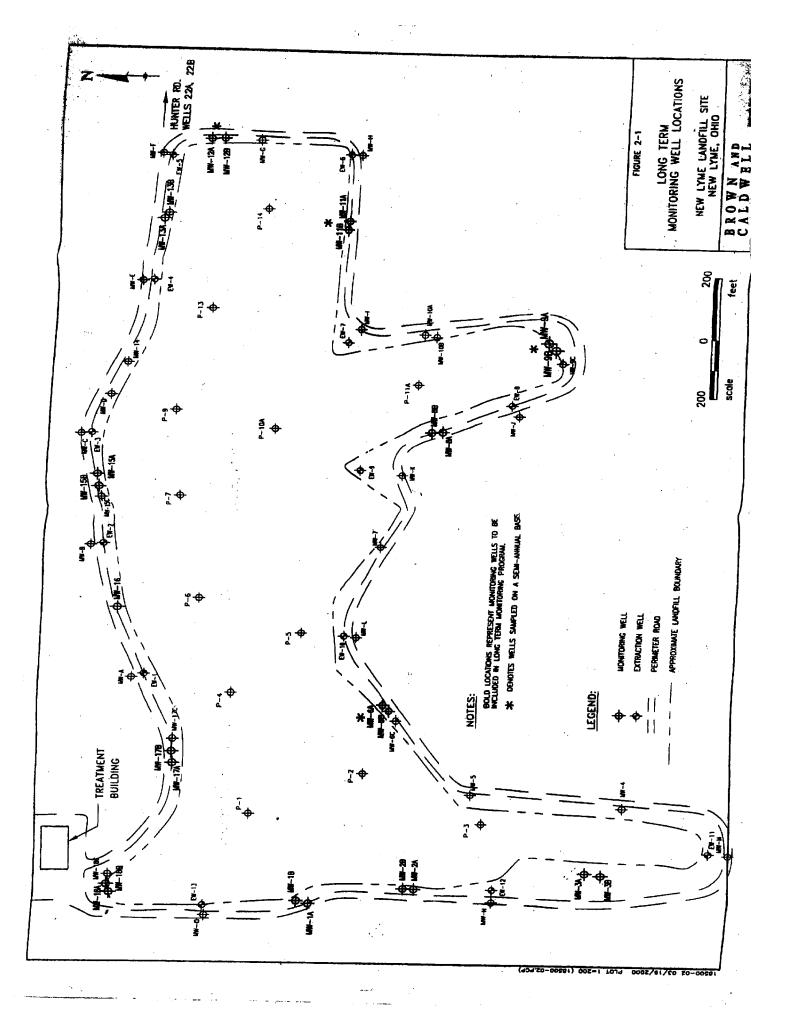

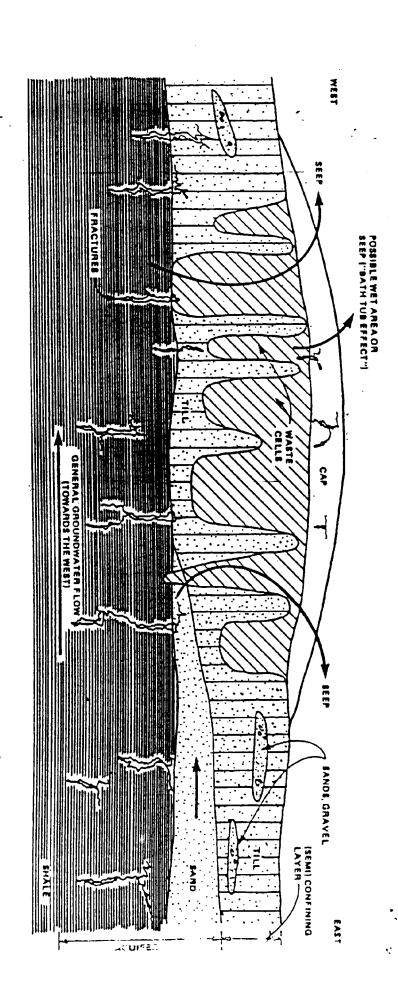
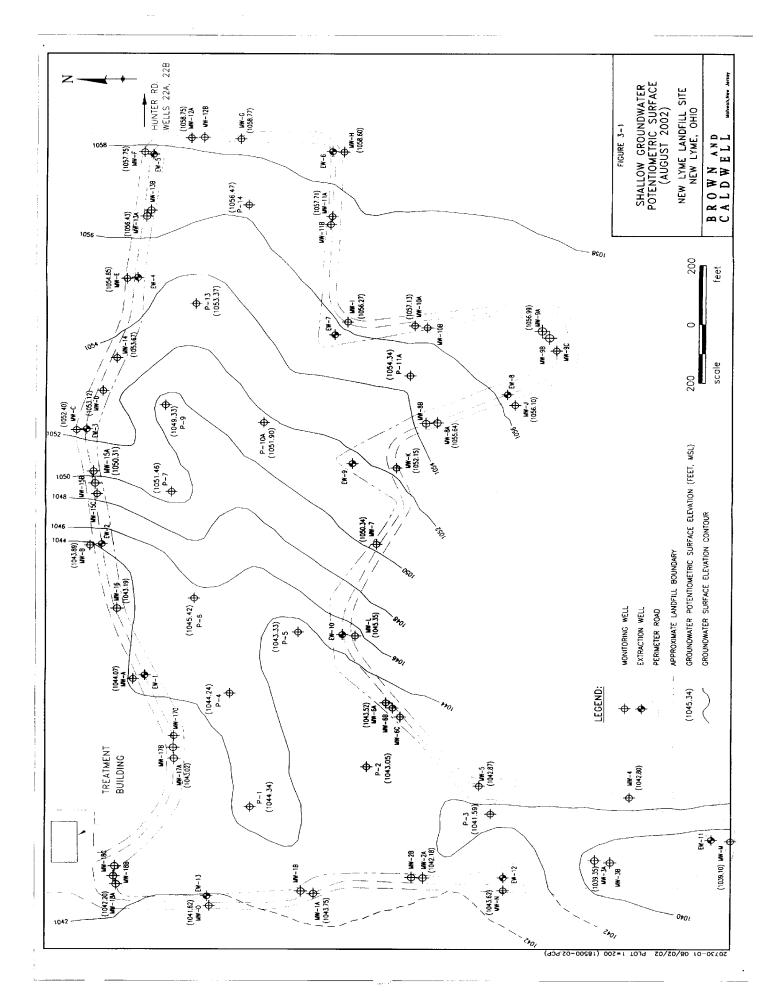
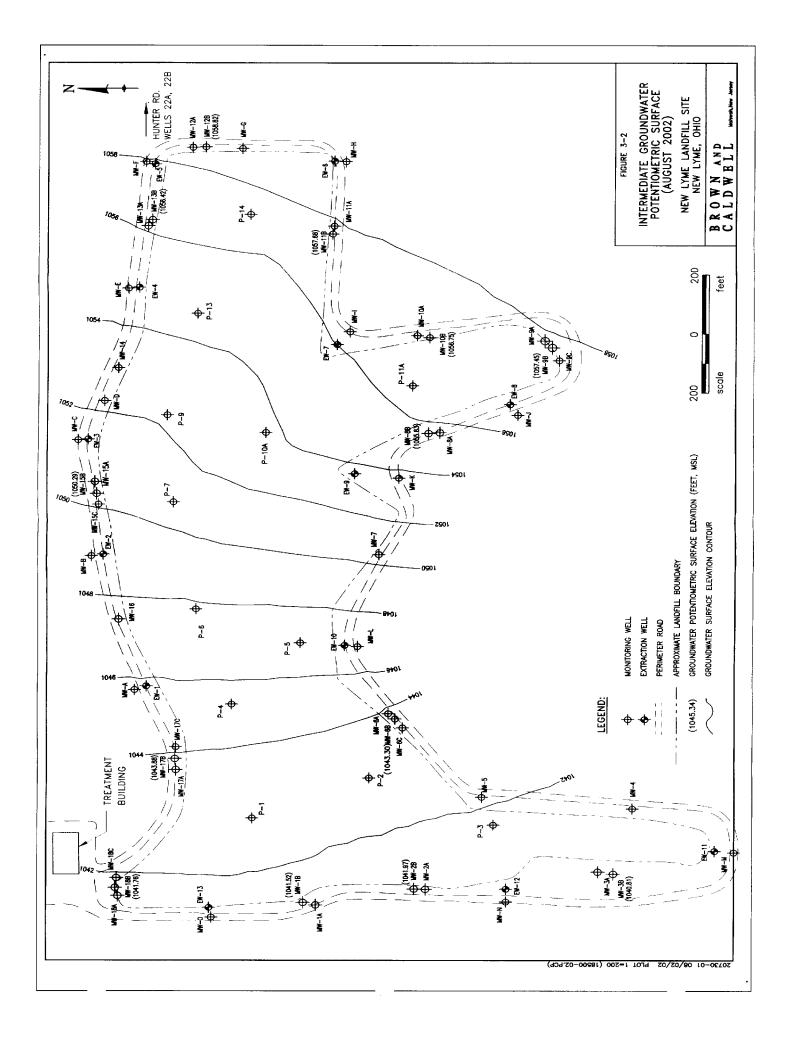


FIGURE .2-A
SCHEMATIC HYDROGEOLOGIC
CROSS SECTION
NEW LYME LANDFILL

i





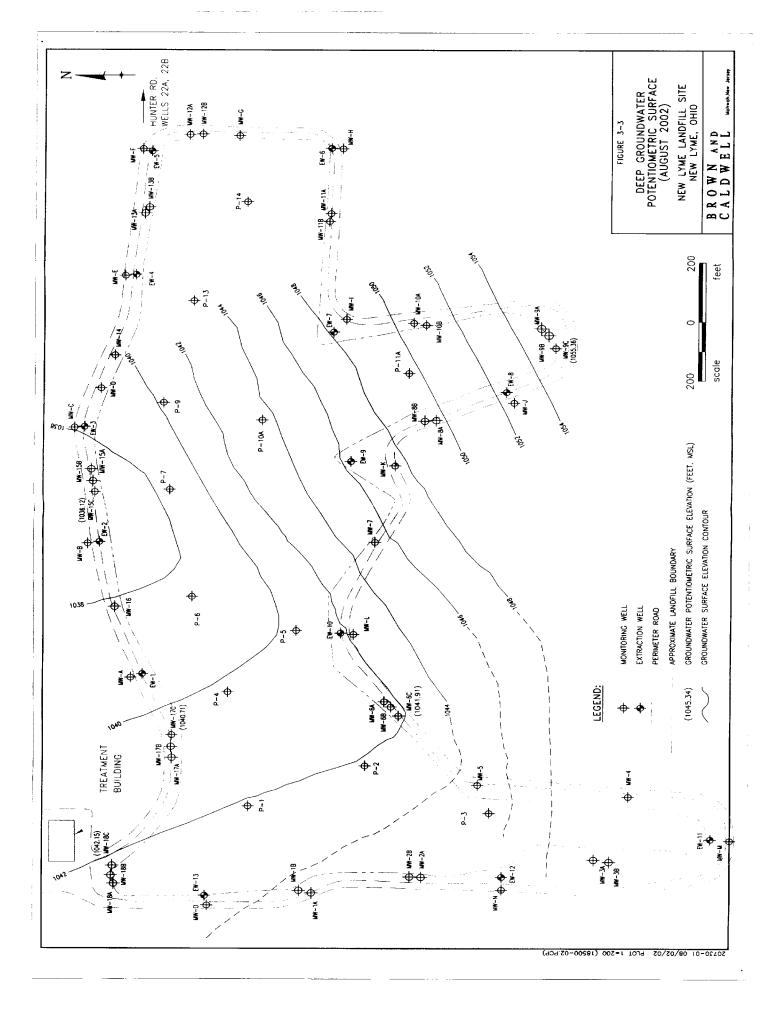


TABLE 1
MONITORING WELLS AND SAMPLE FREQUENCY FOR INCLUSION IN THE LONG-TERM MONITORING PLAN NEW LYME LANDFILL

Monitoring Wells	Monitoring Wells	Residential Wells				
Sampled Quarterly	Sampled Semi-Annually	Name	Address	ID#		
MW-1A	MW-6A	Raymond Kaderly	1266 Dodgeville Road	D01		
MW-1B	MW-6B	Clara Mezinger	1550 Dodgeville Road	D03		
MW-2A	MW-9A	Sherry Monroe	1576 Dodgeville Road	D15		
MW-2B	MW-9B	Don Offutt	1590 Dodgeville Road	D05		
MW-3A	MW-11A	Tom Wallace	1630 Dodgeville Road	D09		
MW-3B	MW-11B	Chester Woznak	1789 Dodgeville Road	D04		
MW-8A	MW-12A					
MW-8B	MW-12B					
MW-13A						
MW-13B						
MW-15A						
MW-15B						
MW-16						
MW-17A						
MW-17B			†			
MW-18A						
MW-18B						
MW-22A						
MW-22B						

TABLE 2 MONITORING WELL ANALYSES FOR INCLUSION IN THE LONG-TERM MONITORING PLAN NEW LYME LANDFILL

Analyses	Method #	Monitoring Wells Sampled Quarterly	Monitoring Wells Sampled Semi-Annually	Residential Wells Sampled Annually
VOCs	8260	Yes	Yes	Yes
SVOCs	8270	Yes	Yes	No
Inorganics	7470A	Yes	Yes	No
TDS	E160.1	Yes	Yes	Yes
Total Cyanide	E335.2	Yes	Yes	No
COD	E410.1	Yes	Yes	Yes
Total Chloride	E300	Yes	Yes	Yes
Ammonia as N	E350.2	Yes	Yes	Yes
Nitrate + Nitrite	E353.3	Yes	Yes	Yes
Sulfate	E375.4	Yes	Yes	Yes
Turbitity	E180.1	Yes	Yes	Yes
Fe, Mn, and Na	6010A	Yes	Yes	Yes
Herbicides	8151	Yes*	Yes	No
Pesticides/PCBs	8081	Yes*	Yes	No

Key:

* = Samples only collected during semi-annual well sampling events.

VOCs = Volatile Organic Compounds.

SVOCs = Semi-Volatile Organic Compounds.

Inorganics = 19 Target Analyte List Metals.

TDS = Total Dissolved Solids.
COD = Chemical Oxygen Demand.

N = Nitrate.

Fe, Mn, and Na = Iron, Manganese, and Sodium.

PCBs = Polychlorinated Biphenyls.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

		or market						GROUN	DWATER	GROUNDWATER ELEVATIONS	Ş			
	*	WELL DEPTHS			18I	1st Round	2nd	2nd Round	3rd	3rd Round	4th	4th Round	5.	5th Round
Well	Original Total Denth	Original Measured Reference	Difference	Reference	Depth to	Depth to Groundwater		Depth to Groundwater	_	Depth to Groundwater		7.	Depth to	Groundwater
	(ft)	(ft)	(ft)	(ft, mel)	(ft)	(ft, msl)	(ft)	(ft, msl)	(f.)	Elevation (ft. msl)	Water (ft)	Elevation (fr. msl)	Water	Elevation
													1	(11, 11181)
On-site Wells	ls.												1	
MW-1A	30.67	30.55	0.12	1050.74	.8.53	1042.21	6.94	1043.80	5.26	1045.48	5.35	1045.39	8,9	1043.75
MW-1B	45.85	37.23	8.62	1050.64	11.49	1039.15	11.37	1039.27	69''	1042.95	6.10	1044.54	9.12	1041.52
MW-2A	31.03	29.87	1.16	1050.38	11.14	1039.24	12.61	1037.77	90.9	1044.32	5.51	1044.87	8.20	1042 18
MW-2B	46.46	37.49	8.97	1050.32	11.14	1039.18	10.68	1039.64	7.04	1043.28	5.65	1044.67	8.35	1041 97
MW-3A	30.79	30.73	90.0	1045.35	7.49	1037.86	7.30	1038.05	3.65	1041.70	3.26	1042.09	90.9	1030 35
MW-3B	45.83	39.35	6.48	1045.35	7.13	1038.22	7.03	1038.32	2.86	1042.49	1.87	1043.48	4 54	1040.81
MW-4	30.77	30.63	0.14	1046.23	4.64	1041.59	3.79	1042.44	0.00	Artesian	-0.39	1046.62	3.43	1042.80
MW-5	30.66	30.45	0.21	1047.32	5.57	1041.75	4 48	1042.64	1.15	1046.17	0.76	1046.56	4 45	1042.87
MW-6A	30.72	29.07	1.65	1049.67	8.27	1041.40	7.18	1042.49	3.06	1046.61	2.90	1046.77	615	1043.52
MW-6B	42.68	42.42	0.26	1049.67	8.66	1041.01	7.78	1041.89	4.05	1045.62	3.30	1046.37	6.37	1043.30
MW-6C	89.23	89.08	0.15	1049.71	17.16	1032.55	12.63	1037.08	26.6	1039.74	7.50	1042.21	7.80	1041 91
MW-7	30.36	29.43	0.93	1053.43	7.18	1046.25	6.22	1047.21	3.36	1050.07	2.96	1050.47	3.09	1050.34
MW-8A	30.49	29.77	0.72	1056.83	2.57	1054.26	1.98	1054.85	0.0	Artesian	-0.75	1057.58	1.19	1055.64
MW-8B	45.21	45.10	0.11	1056.80	2.78	1054.02	2.16	1054.64	0.00	Artesian	-0.76	1057.56	0.97	1055.83
MW-9A	30.28	29.33	0.95	1058.18	1.66	1056.52	1.71	1056.47	0.00	Artesian	-0.85	1059.03	1.19	1056 99
MW-9B	44.57	44.46	0.11	1058.19	2.73	1055.46	7.80	1050.39	0.00	Artesian	-0.71	1058.90	0.74	1057.45
MW-9C	90.94	88.03	2.91	1058.24	4.69	1053.55	4.06	1054.18	2.42	1055.82	2.45	1055.79	2.88	1055.36



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

								GROUN	DWATER	GROUNDWATER ELEVATIONS	S		İ	
	W	WELL DEPTHS	S		191	1st Round	200	2nd Round	1	3rd Round		4th Round	E	Eath Donney
	Original	Measured		Reference	Depth to	Depth to Groundwater	1	Denth to Groundwater		Denth to Gonnadwater		10000		i vound
Well	Total Depth	Total Depth Total Depth Difference Elevation	Difference	Elevation	Water	Elevation		Elevation		Elevation			Water	Flevation
	(ft)	(tt)	(ft)	(ft, msl)	(ft)	(ft, mel)	£)	(ft, mel)	£	(ft, mel)	3	(ft. ms])	(4)	(fr. msl)
														(1)
On-site Wells	ls													
MW-10A	30.15	28.96	1.19	1058.88	2.97	1055.91	2.67	1056.21	1,20	1057 68	010	1058 76	175	1057 13
MW-10B	46.49	45.41	1.08	1058.96	2.81	1056.15	2.69	1056.27	1.15	1057.81	0.10	1058.77	2.21	1057.75
MW-11A	30.39	30.28	0.11	1060.96	3.57	1057.39	3.68	1057.28	2.18	1058.78	1 22	1059.74	3,5	1050.73
MW-11B	47.90	46.52	1.38	1060.94	3.85	1057.09	3.79	1057.15	2.23	1058.71	1.52	1059.42	15	1057.71
MW-12A	30.44	30.82	-0.38	1061.16	2.48	1058.68	2.81	1058.35	1.49	1059.67	0 31	1060 85	241	1050 75
MW-12B	43.80	43.71	0.09	1061.23	2.94	1058.29	5.25	1055.98	2.57	1058.66	1 32	1059 86	1 2	1050.73
MW-13A	30.46	30.32	0.14	1056.32	0.00	Artesian	0.00	Artesian	900	Arregion	80 6-	1058 40	110	1056.43
MW-13B	41.50	40.80	0.70	1056.35	2.45	1053.90	15.82	1040.53	000	Artesian	-2 23	1058 58	000	1056.43
MW-14	30.80	29.35	1.45	1053.81	1.44	1052.37	0.85	1052.96	00.0	Artesian	-2.08	1055.89	0.14	1053.67
MW-15A	30.87	30.08	0.79	1052.98	3.92	1049.06	3.10	1049.88	1.20	1051.78	0.15	1052.83	29.6	1050 31
MW-15B	35.90	35.81	0.09	1053.01	3.85	1049.16	3.32	1049.69	2.32	1050.69	0.16	1052.85	272	1050.29
MW-15C	90.62	90.60	0.02	1053.08	31.94	1021.14	18.00	1035.08	18.82	1034.26	18.19	1034.89	16.96	103612
MW-16	30.67	27.86	2.81	1049.91	7.34	1042.57	6.56	1043.35	3.02	1046.89	2.62	1047 29	672	1043.10
MW-17A	29.76	28.63	1.13	1048.20	5.88	1042.32	5.06	1043.14	42.	1046.66		1047.09	5 18	1043.02
MW-17B	34.13	34.04	0.09	1048.21	6.16	1042.05	5.29	1042.92	2.07	1046.14	1.47	1046.74	4 33	1043.88
MW-17C	91.33	91.27	90.0	1048.28	13.94	1034.34	12.00	1036.28	8.85	1039.43	7.67	1040.61	7.57	104071
MW-18A	30.21	30.10	0.11	1048.45	7.09	1041.36	6.79	1041.66	5.03	1043.42	4.55	1043.90	6.25	1042.20
MW-18B	42.06	41.95	0.11	1048.44	8.16	1040.28	76.7	1040.47	4.75	1043.69	4.25	1044.19	89.9	1041.76



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

								GROUN	DWATER	GROUNDWATER ELEVATIONS	S			
	W	WELL DEPTHS			lst	1st Round	2nd	2nd Round	3rd	3rd Round	4th	4th Round	Sel	5th Round
:	Original	Measured		Reference	Depth to	Depth to Groundwater		Depth to Groundwater Depth to Groundwater	Depth to	Groundwater	Depth to	2	Depth to	Groundwater
Well	Total Depth (ft)	Total Depth Total Depth Difference Elevation (ft) (ft) (ft) (ft, mal)	Difference (ft)	Elevation (ft, msl)	Water (ft)	Elevation (ft, msl)	Water (ft)	Elevation (ft, msl)	Water (ft)	Elevation (ft, msl)	Water (ft)	Elevation (ft. msl)	Water (ft)	Elevation (fr. msl)
On-site Wells	9													
MW-18C	90.49	90.35	0.14	1048.40	8.18	1040.22	8.18	1040.22	7.18	1041.22	4.22	1044.18	6.25	104215
MW-A	30.24	30.27	-0.03	1049.03	6.51	1042.52	5.61	1043.42	2.30	1046.73	1.79	1047.24	4.96	1044.07
MW-B	30.21	28.87	1.34	1051.94	8.92	1043.02	8.39	1043.55	4.86	1047.08	4.11	1047.83	8.05	1043.89
MW-C	30.93	30.86	0.07	1053.77	2.70	1051.07	1.77	1052.00	0.00	Artesian	-1.05	1054.82	1.37	1052.40
MW-D	30.48	30.40	90:0	1054.74	2.85	1051.89	2.01	1052.73	0.00	Artesian	-0.64	1055.38	1.62	1053.12
MW.E	29.72	29.62	0.10	1054.39	1.40	1052.99	0.59	1053.80	00:0	Artesian	-2.49	1056.88	-0.46	1054.85
MW-F	29.64	29.58	90:0	1058.02	1.22	1056.80	89.0	1057.34	0.00	Artesian	-2.17	1060.19	0.27	1057.75
MW-G	30.19	30.14	0.05	1061.93	3.20	1058.73	3.60	1058.33	2.13	1059.80	1.11	1060.82	3.16	1058.77
MW-f1	30.23	30.15	0.08	1061.00	2.36	1058.64	2.73	1058.27	1.26	1059.74	0.29	1060.71	2.40	1058.60
MW-I	29.55	29.43	0.12	1060.59	5.09	1055.50	4.81	1055.78	3.61	1056.98	2.27	1058.32	4.32	1056.27
MW. I	29.79	29.81	-0.02	1056.36	1.99	1054.37	92.0	1055.60	0.00	Artesian	-1.86	1058.22	0.26	1056.10
MW-K	30.69	30.70	-0.01	1055.95	7.50	1048.45	6.11	1049.84	3.80	1052.15	3.05	1052.90	3.80	1052.15
MW-1,	30.67	30.68	-0.01	1051.51	9.04	1042.47	8.00	1043.51	4.47	1047.04	3.61	1047.90	6.16	1045.35
MW-M	30.91	30.91	0.00	1045.05	7.57	1037.48	7.25	1037.80	5.24	1039.81	3.59	1041.46	5.95	1039.10
MW-N	30.52	30.51	0.01	1047.08	8.86	1038.22	89.8	1038.40	4.08	1043.00	2.80	1044.28	3.46	1043.62
MW-O	30.87	30.53	0.34	1050.57	11.00	1039.57	11.07	1039.50	8.15	1042.42	6.31	1044.26	8.95	1041.62

TABLE 3-1

WELL DEPTH AND GROUNDWATER ELEVATION DATA

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

								GROUN	DWATER	GROUNDWATER EL EVATIONS	2			
	W	WELL DEPTHS	S		lat	1st Round	2nd	2nd Bound	200	2nd Done 1				
	Osiginal	Manney						MORNA	P.	Course		4th Kound	5	5th Round
W/All		nainee a		Kererence	Depth to	Depth to Groundwater	Depth to	Groundwater	Depth to	Depth to Groundwater Depth to Groundwater	Depth to	Depth to Groundwater Depth to	Depth to	Groundwater
na Acin	t otal Depth	10(2) Depth 10(2) Depth Difference Elevation	Difference	Elevation	Water	Elevation	Water	Elevation	Water	Elevation	Water	Elevation	Water	Elevation
	(III)	Œ	(E)	(ft, mel)	€	(ft, msl)	(ft)	(ft, msl)	(ft)	(ft, mel)	Œ	(ft, msl)	3	(ft. mal)
													1	
Off-site Wells	lle.													
MW-20B*	NA	33.04	Ϋ́Z	1048.07	12.23	1035.84	13.02	1035.05	63.01	1027 66	90	2000		
MW-20C*	AZ	45.98	Ϋ́Z	1047.84	11 95	1035.90	20.51	1035.03	77.01	1037.33	10.00	1038.0/	12.41	1035.66
MW-21A*	ΑN	07 22		101		20,000	00-1	1033.04	10.10	1037.68	9.66	1038.18	12.08	1035.76
ACIV/ 21 D#		33.07	5	1054.17	10.16	1044:01	12.65	1041.52	5.87	1048.30	5.81	1048.36	10.77	1043.40
MW-21B	ÝŽ.	48.51	¥Z	1053.82	9.04	1044.78	11.61	1042.21	7.05	1046.77	6.57	1047.25	11 41	1042.41
WW-22A	A'A	32.48	Y'A	1065.43	5.38	1060.05	5.88	1059.55	4.30	1061 13	5.40	1060.03	5 70	17.000
MW-22B**	NA.	48.90	YZ.	1065.15	5.52	1059.63	5 05	1059 20	14.4	1000		50.000	0/ 5	103.63
MW-22C**	€Z	97.71	A Z	1064.05	7 24	106774		1037.20		1000.74	9.04	1061.51	5.85	1059.30
				77.001	ţ,	1027.01	15./	105/.04	9.00	1058.95	3.54	1061.41	6.25	1058.70
Piezometers					1				1					
n. 1	2	100												
	1	25.55	A.V.	1063.30	V.	VA	18.75	1044.55	18.46	1044.84	19.95	1043 35	18 96	1044 34
F-2	<z< td=""><td>32.65</td><td>۷ Z</td><td>1063.61</td><td>NA</td><td>NA</td><td>32.65</td><td>1030.96</td><td>16.55</td><td>1047.06</td><td>16.50</td><td>1047 11</td><td>20.54</td><td>1042 05</td></z<>	32.65	۷ Z	1063.61	NA	NA	32.65	1030.96	16.55	1047.06	16.50	1047 11	20.54	1042 05
<u></u>	Ϋ́N	22.40	ΥZ	1059.08	NA	Ϋ́	22.40	1036.68	17.93	1041 15	17.87	1041.21	11,00	1043.03
P-4	Ϋ́Z	27.73	Y.Y	1064.43	Ϋ́Z	Ϋ́Z	27.73	1036.70	20.15	1044.28	20.02	1041.21	17.49	1041.59
P.5	Ϋ́Z	21.67	NA	1063.30	×Z.	¥Z	21.67	1041 63	20.05	20.20	27.02	1044.20	20.19	1044.24
P-6	VZ	22.96	ΥZ	1065 78	Ž	12	10.50	00.1401	50.03	1043.23	19.92	1043.38	19.97	1043.33
P-7	٧Z	21.57	Z	10/0/1		V.	06.77	1042.82	20:05	1045.73	20.43	1045.35	20.36	1045.42
P-9	Y Z	22.20	1 2	1000.07	YZ :	¥Z	21.5/	1047.10	17.15	1051.52	16.65	1052.02	17.21	1051.46
		22::20	VV.	1000.01	ΨZ.	NA	22.20	1044.41	19.16	1047.45	18.19	1048.42	17.28	1049.33

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

								GROUN	DWATER	GROUNDWATER ELEVATIONS	S				_
	M	WELL DEPTHS	S		151	1st Round	2nd	2nd Round	3rd	3rd Round		4th Round	15	Sch Round	
	Original	Measured		Reference	Depth to	Groundwater	Depth to	Groundwater	Depth to	Groundwater	Depth to	Depth to Groundwater Depth to Groundwater Depth to Groundwater Depth to Groundwater Denth to	Depth to	Groundwater	_
Well	Total Depth	Total Depth Total Depth Difference Elevation	Difference		Water	Elevation	Water	Elevation	Water	Elevation	Water	Elevation	Water	Elevation	
	(tt)	(ft)	(tt)	(ft, mel)	(£)	(ft, mel)	£)	(ft, mel)	£	(ft, mel)	£	(ft, mel)	€	(fr. mal)	
Piezometera															
P-10A	NA	28.08	٧V	1072.85	Ϋ́N	٧z	28.08	1044.77	20.95	1051.90	20.51	1052.34	20.95	1051.90	
P-11A	Y'A	22.54	ΥN	1068.96	N.	٧X	22.54	1046.42	15.28	1053.68	14.63	1054.33	14.62	1054.34	
P-13	V.	23.00	ΥN	1070.02	VΑ	VΝ	23.00	1047.02	18.74	1051.28	18.01	1052.01	16.65	1053.37	
P-14	Ϋ́Z	17.70	VA	1072.66	NA	ΥV	17.70	1054.96	16.56	1056.10	16.56	1056.10	16.19	1056.47	

^{* =} Measured from top of protective casing.
** = Measured from top of riser.
NA = Not available.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

W.e.11	Relative.			2								
	JAPIN I			Date Sampled					Arsi	Arsenic		
<u>Q</u>	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	Sth Round	Action I evel
Monitoring Wells	sil.											13.30
MW-1A	Downgradient	9/10/01	11/19/01	2/28/02	5/29/02	8/23/02	<0.020	<0.010	05000>	0500 0>	050000>	
MW-1ADup	Downgradient	9/10/01			5/29/02	8/23/02	<0.020			05000>	05000>	
MW-1B	Downgradient	9/10/01	11/19/01	2/28/02	5/29/02	8/23/02	<0.020	<0.010	0.00833	<0.0050	0.01140	0500
MW-1BD _{up}	Downgradient		11/19/01	2/28/02		_	-	<0.010	0.0093			0500
MW-2A	Downgradient	9/10/01	11/16/01	2/28/02	5/28/02	8/22/02	<0.020	0.0114		<0.0050	<0.010	0500
MW-2B	Downgradient	9/10/01	10/61/11	2/28/02	5/29/02	8/22/02	<0.020	<0.010	0.0058	<0.0050	0.0150	0500
MW-3A	Downgradient	9/7/01	11/16/01	2/27/02	5/28/02	8/21/02	0.0276	0.0276	0.0317	0.0277	0.0465	0500
MW-3B	Downgradient	9/7/01	11/16/01	2/27/02	5/28/02	8/21/02	<0.020	<0.010	0.0131	<0.0050	0.00705	0500
MW-6A	Sidegradient-S	9/1/01	•	2/27/02	5/28/02		<0.020		0.0113	<0.0050		0500
MW-6ADup	Sidegradient-S	10/2/6					<0.020			,		86.5
MW-6B	Sidegradient-S	10/L/6	-	2/27/02	5/28/02		<0.020		0.00861	0.0148	,	0.050
MW-8A	Sidegradient-S	10/9/6	11/15/01	2/27/02	5/24/02	8/21/02	0.0426			0.0342	0.0348	0.050
MW-8B	Sidegradient-S	10/9/6	11/16/01	2/21/02	5/24/02	8/21/02	<0.020	0.0105	0.0144	<0.0050	0.0171	0.050
MW-9A	Sidepradient-S	9/6/01		2/26/02	5/23/02		0.0325		0.0203	410.0		0.050
MW-9B	Sidegradient-S	10/9/6	•	2/26/02	5/23/02	-	<0.020		0.0166	0.00872		0.050
MW-11A	Uppradient-S	9/5/01	-	2/26/02	5/23/02	-	<0.020	•	0.00913	<0.0050	,	0.050
MW-11ADup	Uppradient-S	9/5/01	-	2/26/02	5/23/02		<0.020		96000	0.00639		0.050
MW-11B	Upgradient-S	9/5/01	'	2/26/02	5/24/02	-	<0.020		0.00864	<0.0050		0.050
MW-12A	Upgradient	9/5/01	•	2/25/02	5/23/02		<0.020		0.0133	0.0110		0.050
MW12B	Upgradient	9/5/01	,	2/22/02	5/23/02		<0.020		0.00728	<0.0050		0.050

- Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm;mg/L).
 Shaded values exceed the Action Level (MCL).
 A "" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

^{&#}x27;Location of well relative to groundwater flow direction. N=north, S=south, OS=off-site.

Priest value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relative1			Barium	um					Beryllium	띭		
Ω	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level
Monitoring Wells	8												
MW-1A	Downgradient	0.0917	6880.0	0.0859	0.0673	0.0628	-	<0.0050	<0.0040	<0.0040	<0.0040	<0.0010	
MW-1ADup	Downgradient	0.0881	,		90.00	0.0554		<0.0050	 - 		<0.0040	<0.0010	
MW-1B	Downgradient	0.0943	0.0918	0.105	0.114	0.100	1	<0.0050	<0.0040	<0.0040	<0.0040	< 0.0010	
MW-1BDup	Downgradient		0.0916	0.104			1	•	<0.0040	<0.0040			
MW-2A	Downgradient	0.0979	0.129	0.47	0.0564	0.0457	1	<0.0050	<0.0040		0 0 0000	<0.0010	0.004
MW-2B	Downgradient	0.055	0.048	0.0518	0.0548	0.0512	-	<0.0050	<0.0040	<0.0040	<0.0040	<0.0010	
MW-3A	Downgradient	0.155	0.141	0.155	0.130	0.117	1	<0.0050	<0.0040	<0.0040	<0.0040	<0.0010	,
MW-3B	Downgradient	0.105	0.110	0.139	0.115	0.1050	[<0.0050	<0.0040	<0.0040	<0.0040	<0.0010	
MW-6A	Sidegradient-S	9200	,	0.0872	0.0721		-	<0.0050		<0.0040	<0.0040		
MW-6ADup	Sidegradient-S	0.074	,		ļ.	ļ.	1	<0.0050					
MW-6B	Sidegradient-S	0.133		0.132	0.0883	,	1	<0.0050	•	<0.0040	<0.0040	1	
MW-8A	Sidegradient-S	0.0737	0.0747	0.0913	0.0830	0.0664	1	<0.0050	<0.0040	<0.0040	<0.0040	<0.0010	
MW-8B	Sidegradient-S	0.0286	0.0274	0.0353	0.0309	0.0290	1	<0.0050	<0.0040	<0.0040	<0.0040	<0.0010	
MW-9A	Sidegradient-S	0.0837	-	0.0854	0.0785		-1	<0.0050		<0.0040	<0.0040		
MW-9B	Sidegradient-S	0.0439	-	0.103	0.0627	,	1	<0.0050	·	<0.0040	<0.0040		
MW-11A	Upgradient-S	0.0748	-	0.0855	0.0823		1	<0.0050		<0.0040	<0.0040		
MW-11ADup	Upgradient-S	0.0229		0.084	0.0807	,	1	<0.0050		<0.0040	<0.0040		
MW-11B	Upgradient-S	0.053	-	0.0595	0.0600		1	<0.0050	,	<0.0040	<0.0040		
MW-12A	Upgradient	0.0754	,	0.0835	0.0879		1	<0.0050	,	<0.0040	<0.0040		
MW12B	Upgradient	0.0213	-	0.0242	0.0244		1	<0.0050	,	<0.0040	<0.0040		

Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm;mg/L).
 Shaded values exceed the Action Level (MCL).

A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north, S=south, OS=off-site.

Pirst value represents initial exceedance/Second value represents confirmation sampling result.





QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Weels Location 1st Round 3rd Round 4th Round 5th Round Action Level 1st Round 3rd Round Downgradient
--

Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm,mg/L).
 Shaded values exceed the Action Level (MCL).

⁻ A "-" indicates that either monitoring well was not sampled or parameter was not tested for. - A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).

The associated value is the Reporting Limit (RL)

¹Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

²First value represents initial exceedance/Second value represents confirmation sampling result.





QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative			Nickel						Thallium	Ę		
ID	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level
Monitoring Wells	S												
MW-1A	Downgradient	<0.0050	<0.0050	0.00981	<0.0050	<0.0050	0.1	<0.020	<0.0030	<0.0080	<0.0030	<0.0050	
MW-1ADup	Downgradient	<0.0050			<0.0050	<0.0050		<0.020			<0.0030	<0.0050	
MW-1B	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050		<0.020	<0.0030	<0.0080	<0.0030	<0.0030	
MW-1BDup	Downgradient	٠	0500:0>	<0.0050				•	<0.0030	<0.0080	-		
MW-2A	Downgradient	0.0173	0.0215		0.00854	0.00523	0.1	<0.020	<0.0030	<0.0080	<0.0030	<0.0070	
MW-2B	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050		<0.020	<0.0030	<0.0080	<0.0030	<0.0030	
MW-3A	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050		<0.020	<0.0030	<0.0030	<0.0030	<0.0030	
MW 3B	Downgradient	<0.0050	<0.0050	<0.0050	0.0239	<0.0050	0.1	<0.020	<0.0030	<0.0030	<0.0030	<0.0030	
MW-6A	Sidegradient-S	<0.0050		<0.0050	<0.0050	,		<0.020		<0.0030	<0.0030		
MW-6ADup	Sidegradient-S	<0.0050	-	_				<0.020	-	-	,		
MW-6B	Sidegradient-S	<0.0050	-	<0.0050	<0.0050	-		<0.020		<0.0030	<0.0030	·	
MW-8A	Sidegradient-S	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050		<0.020	<0.0030	<0.0030	<0.0030	<0.0030	
NfW-8B	Sidegradient-S	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050		< 0.020	<0.0030	<0.0030	<0.0030	<0.0030	
MW-9A	Sidegradient-S	<0.0050		<0.0050	<0.0050	•		< 0.020	-	<0.0030	<0.0030	,	
MW-9B	Sidegradient-S	<0.0050		0.0128	<0.0050	•	0.1	<0.020	•	<0.0030	<0.0030		
MW-11A	Upgradient-S	<0.0050		<0.0050	<0.0050	-		<0.020	-	<0.0030	<0.0030		
MW-11ADup	Upgradient-S	<0.0050	,	<0.0050	<0.0050	•		< 0.020		< 0.0030	<0.0030		
MW-11B	Upgradient-S	<0.0050		<0.0050	<0.0050			<0.020		<0.0030	<0.0030		
MW-12A	Upgradient	<0.0050	-	<0.0050	<0.0050			<0.020			<0.0030	,	0.002
MW12B	Upgradient	<0.0050	,	<0.0050	<0.0050	•		<0.020	-		<0.0030		0.002

⁻ Table includes only those parameters that were detected in at least one sample.

All values are expressed in units of parts per million (ppm,mg/L).
 Shaded values exceed the Action Level (MCL).
 A.". indicates that either monitoring well was not sampled or parameter was not tested for.
 A.". "Indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

Pinst value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative			Cobalt					Copper		
QI	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	ls										
MW-1A	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	0.0109	0.0464	<0.010	<0.010
MW-1ADup	Downgradient	<0.0050			<0.0050	<0.0010	<0.010			<0.010	<0.010
MW-1B	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-1BDup	Downgradient	٠	<0.0050	<0.0050	-			<0.010	<0.010	,	
MW-2A	Downgradient	0.0154	0.0129	0.0715	<0.0050	0.00354	<0.010	0.0293	0.191	<0.010	<0.010
MW-2B	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-3A	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-3B	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-6A	Sidegradient-S	<0.0050		<0.0050	<0.0050		<0.010		<0.010	<0.010	
MW-6ADup	Sidegradient-S	<0.0050		,			<0.010	,			
MW-6B	Sidegradient-S	<0.0050		<0.0050	<0.0050		<0.010	,	<0.010	<0.010	
MW-8A	Sidegradient-S	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	0.0106	<0.010	<0.010	01005
MW-8B	Sidegradient-S	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	<0.010	<0.010	<0.010	<0.000
MW-9A	Sidegradient-S	<0.0050		<0.0050	<0.0050		<0.010		<0.010	<0.010	
MW-9B	Sidegradient-S	<0.0050		0.0159	0.0102	,	<0.010		<0.010	<0.010	,
MW-11A	Upgradient-S	<0.0050		<0.0050	<0.0050	,	<0.010		<0.010	<0.010	-
MW-11ADup	Upgradient-S	<0.0050	_	<0.0050	<0.0050		<0.010	,	<0.010	<0.010	
MW-11B	Upgradient-S	<0.0050		<0.0050	<0.0050		<0.010	,	<0.010	<0.010	
MW-12A	Upgradient	<0.0050	•	<0.0050	<0.0050	,	<0.010		<0.010	<0.010	,
MW12B	Upgradient	<0.0050		<0.0050	<0.0050		<0.010		<0.010	<0.010	

Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm.mg/1).
 Shaded values exceed the Action Level (MCI.).
 A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).

The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

First value represents initial exceedance/Second value represents confirmation sampling result.

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative			Iron					Manganese		
Ü	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	18										
MW-1A	Downgradient	3.32	4.01	2.2	<0.050	0.0264	0.38	0.103	0.106	<0.050	<0.0050
MW-1ADup	Downgradient	2.71	•	•	0.0780	0.0420	0.357		•	<0.050	<0.0050
MW-1B	Downgradient	0.588	0.625	0.743	0.122	0.0322	<0.050	<0.050	<0.050	<0.050	0.0163
MW-1BDup	Downgradient		0.581	0.64		-	_	<0.050	<0.050	•	
MW-2A	Downgradient	1.74	17.9	159	0.261	1.08	207	3.11	4.68	3.43	2.88
MW-2B	Downgradient	0.463	0.375	0.365	0.100	0.473	<0.050	<0.050	<0.050	<0.050	0.0317
MW-3A	Downgradient	5.89	1.61	2.25	2.32	2.03	0.394	0.277	0.359	0.340	0.329
MW-3B	Downgradient	0.408	0.369	0.715	0.115	<0.020	<0.050	<0.050	0.0512	<0.050	<0.0050
MW-6A	Sidegradient-S	5.3	,	5.69	5.37	•	0.18	•	0.206	0.190	-
MW-6ADup	Sidegradient-S	5.12	-	-	,	-	0.175	,	•	,	
MW-6B	Sidegradient-S	0.893	-	0.993	1.47		< 0.050	•	0.0528	0.0578	1
MW-8A	Sidegradient-S	2.26	4.68	1.1	0.455	0.348	0.204	0.237	0.299	0.311	0.186
MW-8B	Sidegradient-S	0.596	0.605	0.699	0.285	0.551	0.13	0.126	0.157	0.0792	0.155
MW-9A	Sidegradient-S	8.48	-	1.43	0.971		0.217	-	0.195	0.285	
MW-9B	Sidegradient-S	1.3	•	9.5	3.48	-	0.151		0.28	0.207	,
MW-11A	Upgradient-S	0.784		0.776	0.252		0.163	•	0.17	0.313	
MW-11ADup	Upgradient-S	0.612	-	0.757	0.252	_	0.105	-	0.178	0.266	
MW-11B	Upgradient-S	0.652		0.967	0.176	-	0.139		0.174	<0.050	
MW-12A	Upgradient	0.72	•	0.606	0.702	,	0.154	1	0.175	0.182	
MW12B	Upgradient	0.555	,	0.532	0.175	•	0.098		0.108	0.122	

⁻ Table includes only those parameters that were detected in at least one sample.

⁻ All values are expressed in units of parts per million (ppm;mg/L). Shaded values exceed the Action Level (MCL).

A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "-" indicates that the parameter was not detected above the Method Detection Limit (MDL).

Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site. The associated value is the Reporting Limit (RL).

Pirst value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative			Sodium					Zinc		
Ω	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	lls										
MW-1A	Downgradient	16	18	18.1	17.3	18.5	<0.020	0.0239	<0.020	<0.020	<0.0050
MW-1ADup	Downgradient	16.1	•	-	17.8		<0.020	-	1	<0.020	0.00685
MW-1B	Downgradient	6.44	46.4	47.9	45.3	43.4	<0.020	<0.020	<0.020	<0.020	<0.0050
MW-1BDup	Downgradient	,	44	47.7	,	,	•	<0.020	<0.020		
MW-2A	Downgradient	41.8	34.2	30.7	29.8	27.4	0.0383	0.0532	0.436	<0.020	<0.0050
MW-2B	Downgradient	43.5	46.9	44.5	44.3	427	0.046	<0.020	<0.020	<0.020	0.00657
MW-3A	Downgradient	18.5	20.2	23.3	19.3	19.6	<0.020	<0.020	<0.020	<0.020	<0.0050
MW-3B	Downgradient	29	33.1	37.9	32.7	31.9	<0.020	<0.020	<0.020	<0.020	<0.0050
MW-6A	Sidegradient-S	19.1	•	27.4	28.9		<0.020		<0.020	<0.020	
MW-6ADup	Sidegradient-S	18.6	•				<0.020	-			
MW-6B	Sidegradient-S	41.5	-	46.9	42.8	-	<0.020		0.0261	<0.020	
MW-8A	Sidegradient-S	6.46	7.88	8.91	7.96	6.85	<0.020	<0.020	0.0223	<0.020	<0.0050
MW-8B	Sidegradient-S	6.73	7.23	9.13	8.81	8.8	<0.020	<0.020	<0.020	<0.020	<0.0050
MW-9A	Sidegradient-S	7.35	,	9.37	8.12		<0.020		<0.020	< 0.020	
MW-9B	Sidegradient-S	7.3		8.81	8.29	•	<0.020		0.0306	< 0.020	
MW-11A	Upgradient-S	7.48	•	8.41	7.93	•	<0.050	-	<0.020	<0.020	
MW-11ADup	Upgradient-S	9.9		8.37	7.84	-	<0.050		0.023	<0.020	,
MW-11B	Uppradient-S	7.64	,	8.84	8.72	,	<0.050	•	0.0208	<0.020	
MW-12A	Upgradient	7.11	,	7.26	7.53	,	<0.050	•	<0.020	<0.020	,
MW12B	Upgradient	9.62	,	10.5	11.1	•	<0.050		<0.020	<0.020	,

Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm,mg/L).
 Shaded values exceed the Action Level (MCL).

 ⁻ A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 - A "-" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

^{1.0}cation of well relative to grandwater flow direction. N=north, S=south, OS=off-site.

Prist value represents initial exceedance/Second value represents confirmation sampling result.

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative			Chloride					Sulfate		
Π	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	lls										
MW-1A	Downgradient	10.3	9.01	11.2	8.78	9.57	135	167	159	17.2	162
MW-1ADup	Downgradient	10.7			8.45	9,48	131	•		16.7	156
MW-1B	Downgradient	10.6	11.2	10.7	7.41	6.36	21.7	13.6	11.9	11.4	11.3
MW-1BDup	Downgradient		11	11	-		•	11.3	11.6		•
MW-2A	Downgradient	\$9.8	6.16	8.47	8.08	4.72	193	237	300	231	282
MW-2B	Downgradient	97	23.4	23.7	20.5	19.1	9.46	8.34	8.5	7.42	8.45
MW-3A	Downgradient	5.15	3.91	4.94	5.42	6.55	104	98.9	107	9.68	100
MW-3B	Downgradient	13.2	13.2	21	20.3	10.5	7.48	8.12	7.74	8.52	8.10
MW-6A	Sidegradient-S	10.9	. 1	12	8.61	-	107	-	115	107	1
MW-6ADup	Sidegradient-S	10.9	,	•		-	106	1	•	,	
MW-6B	Sidegradient-S	8.62	-	74.9	48.6		46	,	38.2	22.2	
MW-8A	Sidegradient-S	3.37	2.83	3.44	2.37	3.01	22	21.7	19.8	20.2	23.1
MW-8B	Sidegradient-S	3.42	3.23	4.36	2.71	4.56	21.3	24.2	26.9	22.2	24.4
MW-9A	Sidegradient-S	3.73		5.29	3.22	-	25.7	-	31.4	24.8	,
MW-9B	Sidegradient-S	3.96		4.48	3.20		22.8	,	24.6	24.2	
MW-11A	Upgradient-S	6.77		4.18	2.74	_	30.1	•	20.9	19.9	
MW-11ADup	Upgradient-S	3.32	•	4.52	2.55	-	19.6	-	26.2	19.4	
MW-11B	Upgradient-S	3.26	,	4.41	2.47		19.9	'	27.8	19.1	
MW-12A	Upgradient	10.1		12.6	8.88	F	38.4	·	47.9	34.1	,
MW12B	Upgradient	96.9	,	7.9	7.31	•	31.2	-	36.6	34.2	

- Table includes only those parameters that were detected in at least one sample.
- All values are expressed in units of parts per million (ppm.mg/L).
 Shaded values exceed the Action Level (MCL).
 A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "-" indicates that the parameter was not detected above the Method Detection Limit (MDL). The associated value is the Reporting Limit (RL).
- 'Location of well relative to groundwater flow direction. N=north, S=south, OS=off-site.
- Pirst value represents initial exceedance/Second value represents confirmation sampling result.

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relauve			Ammonia				Z	Nitrate-Nitrate (as N	6	
ΩI	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	lle										
MW-1A	Downgradient	0.34	<0.20	0.22	0.34	<0.20	<0.327	<0.0530	<0.05	<0.053	<0.053
MW-1ADup	Downgradient	1.1	1		0.22	<0.20	<0.327	•		<0.053	<0.053
MW-1B	Downgradient	<0.20	0.45	0.34	0.22	<0.20	<0.327	<0.0530	<0.05	0.251	0.220
MW-1BDup	Downgradient	,	0.56	0.34				<0.0530	<0.05		
MW-2A	Downgradient	<0.20	<0.20	0.34	0.34	<0.20	<0.327	<0.0530	<0.05	<0.053	<0.053
MW-2B	Downgradient	0.0	6.0	0.56	0.22	0.28	<0.327	<0.0530	<0.05	0.108	0.0823
MW-3A	Downgradient	0.22	0.34	<0.20	0.45	<0.20	<0.05	<0.0530	<0.05	<0.053	<0.053
MW-3B	Downgradient	0.56	6.0	<0.20	0.45	<0.20	<0.05	<0.0530	<0.05	0.242	0.452
MW-6A	Sidegradient-S	<0.20		<0.20	0.45	,	<0.05		<0.05	<0.053	-
MW-6ADup	Sidegradient-S	<0.20	•				<0.05	,	,		ı
MW-6B	Sidegradient-S	0.45	-	0.67	0.67	-	<0.05	,	<0.05	<0.053	,
MW-8A	Sidegradient-S	<0.20	<0.20	<0.20	<0.20	<0.20	0.0598	<0.0530	<0.05	<0.053	<0.053
MW-8B	Sidegradient-S	<0.20	<0.20	<0.20	0.22	<0.20	<0.0530	<0.0530	<0.05	<0.053	<0.053
MW-9A	Sidegradient-S	<0.20	•	<0.20	<0.20	,	<0.0530		<0.05	<0.053	,
MW-9B	Sidegradient-S	0.22	•	< 0.20	<0.20		<0.0530		<0.05	<0.053	,
MW-11A	Upgradient-S	<0.20	-	0.22	<0.20	,	<0.0530	,	<0.05	<0.053	
MW-11ADup	Upgradient-S	0.22		0.22	<0.20		<0.0530	1	<0.05	<0.053	
MW-11B	Upgradient-S	<0.20	·	0.34	0.22		<0.0530		<0.05	0.0585	,
MW-12A	Upgradient	<0.20	•	0.22	<0.20		<0.0530	,	<0.05	<0.053	
MW12B	Upgradient	0.22	•	<0.20	0.28	-	<0.0530	-	<0.05	<0.053	,

Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm,mg/L).
 Shaded values exceed the Action Level (MCL).

- A "." indicates that either monitoring well was not sampled or parameter was not tested for.
- A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).

The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north, S=south; OS=off-site.

Prinst value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative ¹			TDS					COD		
CII	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	ls										
MW-1A	Downgradient	009	610	099	099	049	<10	<10	<10	<10	<10
MW-1ADup	Downgradient	280	•		099	059	<10	,		<10	11
MW-1B	Downgradient	290	280	330	340	290	<10	<10	<10	<10	<10
MW-1BDup	Downgradient	•	310	320	-	-	-	<10	<10	1	
MW-2A	Downgradient	930	1100	1100	1100	026	<10	380	34	<10	11
MW-2B	Downgradient	320	300	330	310	290	10	<10	<10	<10	<10
MW-3A	Downgradient	620	570	009	009	610	19	18	<10	<10	12
MW-3B	Downgradient	300	300	340	290	310	25	16	<10	<10	<10
MW-6A	Sidegradient-S	620		999	260	-	20		<10	<10	,
MW-6ADup	Sidegradient-S	620			-		18		-		,
MW-6B	Sidegradient-S	520	-	460	410		22		<10	<10	
MW-8A	Sidegradient-S	320	270	300	280	340	14	10	<10	<10	12
MW-8B	Sidegradient-S	330	280	290	290	280	17	15	<10	<10	<10
MW-9A	Sidegradient-S	330	-	290	280		<10		<10	10	,
MW-9B	Sidegradient-S	340	,	300	300	•	19	•	<10	<10	
MW-11A	Upgradient-S	340		270	300		13		<10	<10	
MW-11ADup	Upgradient-S	330	-	280	280		<10		<10	<10	
MW-11B	Upgradient-S	320	,	270	290	•	<10		<10	<10	
MW 12A	Upgradient	069		310	290	·	13		<10	14	
MW12B	Upgradient	330	,	300	330	-	<10	,	<10	13	

- Table includes only those parameters that were detected in at least one sample.
- All values are expressed in units of parts per million (ppm.mg/L).
 Shaded values exceed the Action Level (MCL).
 A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL). The associated value is the Reporting Limit (RL).

¹Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

Prist value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Me∐	Relative	Bis(2	Bis(2-Ethylhexyl)phthalate	alate	Diethyl Phthalate
QI	Location	4th Round	5th Round	Action Level	5th Round
Monitoring Wells	ls				
MW-1A	Downgradient	<0.010	< 0.010		<0.010
MW-1ADup	Downgradient	<0.010	<0.010		<0.010
MW-1B	Downgradient	<0.010	<0.010		<0.010
MW-1BDup	Downgradient	-			
MW-2A	Downgradient	<0.010	<0.010		<0.010
MW-2B	Downgradient	<0.010	<0.010		<0.010
MW-3A	Downgradient	<0.010	<0.010		<0.010
MW-3B	Downgradient	< 0.010	< 0.010		<0.010
MW-6A	Sidegradient-S	<0.010	,		
MW-6ADup	Sidegradient-S	•			
MW-6B	Sidegradient-S			9000	
MW-8A	Sidegradient-S	<0.010	<0.010		<0.010
MW-8B	Sidegradient-S	< 0.010	<0.010		<0.010
MW-9A	Sidegradient-S	<0.010			
MW-9B	Sidegradient-S	<0.010			
MW-11A	Upgradient-S	<0.010			
MW-11ADup	Upgradient-S	<0.010			
MW-11B	Upgradient-S	< 0.010			
MW-12A	Upgradient	<0.010	,		
MW12B	Upgradient	<0.010	,		

- Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppm,mg/L).
 Shaded values exceed the Action Level (MCL).

- A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).
- Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

 First value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relative			Date Sampled					Arsenic	TILC		
CI	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level
Monitoring Wells	ls.											
MW-13A	Upgradient-N	8/31/01	11/15/01	2/22/02	5/22/02	8/21/02	<0.020	<0.010	<0.0050	<0.0050	0.0148	0.050
MW-13ADup	Upgradient-N		11/15/01		,			<0.010				
MW-13B	Upgradient-N	8/31/01	11/15/01	2/25/02	5/22/02	8/21/02	<0.020	<0.010	0.00768	<0.0050	<0.0050	0.050
MW-15A	Sidegradient-N	8/30/01	11/15/01	2/22/02	5/22/02	8/20/02	<0.020	<0.010	<0.0050	<0.0050	<0.0050	
MW-15ADup	Sidegradient-N		•		•	8/20/02			•		<0.0050	
MW-15B	Sidegradient-N	8/31/01	11/12/01	2/22/02	20/22/5	8/20/02	<0.020	<0.010	<0.0050	<0.0050	<0.0050	
MW-16	Sidegradient-N	8/30/01	11/15/01	2/22/02	5/22/02	8/20/02	<0.020	<0.010	<0.0050	<0.0050	<0.0050	
MW-16Dup	Sidegradient-N				5/22/02	•			•	<0.0050		
MW-17A	Sidegradient-N	8/30/01	11/14/01	2/21/02	5/21/02	8/20/02	<0.020	<0.010	<0.010	<0.0050	<0.0050	
MW-17B	Sidegradient-N	8/30/01	11/14/01	2/21/02	5/21/02	8/20/02	<0.020	<0.010	<0.010	<0.0050	<0.0050	
MW-18A	Downgradient	9/11/01	11/14/01	2/28/02	5/29/02	8/23/02	0.0398	0.0494		0.0156	65£0.0	0.050
MW-18B	Downgradient	10/11/6	11/14/01	2/28/02	5/29/02	8/23/02	<0.020	< 0.010	<0.0050	<0.0050	<0.0050	
MW-18BIJup	Downgradient		-	2/28/02		,	-		<0.0050		,	
MW-22A	Upgradient-OS	8/27/01	11/19/01	2/21/02	5/21/02	8/22/02	< 0.020		0.0088	0.00609	0.0135	0:020
MW-22B	Upgradient-OS	8/29/01	11/19/01	2/21/02	5/21/02	8/22/02	<0.020	<0.010	<0.0050	<0.0050	0.0130	0.050
Residential Wells	8											
Dot		8/29/01	,		-	8/22/02					,	
D03		10/11/6	,	-	1	9/5/02	-	-			,	
D04		9/11/01	-	-		8/22/02	-	,	-			
D05		9/10, 25/01				9/5/02	-	•	•			
D09		9/11/01				-	_	•				
D15		9/11/01		-		8/22/02			•			

tr / C+

⁻ Table includes only those parameters that were detected in at least one sample.

All values are expressed in units of parts per million (ppm,mg/L).

⁻ Shaded values exceed the Action Level (MCL).

 ⁻ A "-" indicates that either morntoning well was not sampled or parameter was not tested for.
 - A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

Pirst value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

- Table includes only those parameters that were detected in at least one sample.

- All values are expressed in units of parts per million (ppm;mg/L).

- Shaded values exceed the Action Level (MCL).

A "" indicates that either monitoring well was not sampled or parameter was not tested for.

A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL). The associated value is the Reporting Limit (RL).

'Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

²First value represents mutal exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relative1			Chromum	wr					Lead			
Œ	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level	1st Round	2nd Round	3rd Round	4th Round	5th Round	Action Level
Monitoring Wells	<u>81</u>												
MW-13A	Upgradient-N	< 0.010	<0.0070	<0.0050	<0.0050	<0.0050		<0.010	<0.010	<0.010	<0.010	<0.010	
MW-13ADup	Upgradient-N	-	<0.0070	,	٠	-			< 0.010	1	-		
MW-13B	Upgradient-N	< 0.010	<0.0070	0.00837	<0.0050	<0.0050	0.1	< 0.010	<0.010	<0.010	< 0.010	< 0.010	
MW-15A	Sidegradient-N	< 0.010	<0.0070	<0.0050	<0.0050	<0.0050		<0.010	<0.010	<0.010	<0.010	<0.010	
MW-15.ADup	Sidegradient-N					<0.0050		-	•	•	,	< 0.010	
MW-15B	Sidegradient-N	<0.010	<0.0070	<0.0050	<0.0050	<0.0050		< 0.010	<0.010	<0.010	<0.010	<0.010	
MW-16	Sidegradient-N	< 0.010	<0.0070	<0.0050	<0.0050	<0.0050		< 0.010	<0.010	< 0.010	< 0.010	< 0.010	
WW-16Dup	Sidegradient-N			•	<0.0050	,			_	,	<0.010		
MW-17A	Sidegradient-N	<0.010	<0.0070	<0.0050	<0.0050	<0.0050		<0.010	<0.010	<0.010	<0.010	0.0136	0.05
MW-17B	Sidegradient-N	< 0.010	<0.0070	<0.0050	<0.0050	<0.0050		< 0.010	<0.010	< 0.010	<0.010	<0.010	
MW-18A	Downgradient	<0.010	<0.0070	0.00515	<0.0050	<0.0050	0.1	<0.010	<0.010	< 0.010	< 0.010	< 0.010	
MW-18B	Downgradient	<0.010	0,00070	<0.0050	<0.0050	<0.0050		< 0.010	<0.010	< 0.010	<0.010	<0.010	
MW-18BDup	Downgradient	,		<0.0050	,				,	< 0.010	•	-	
MW-22A	Upgradient-OS	<0.010	<0.0070	<0.0050	<0.0050	<0.0050		<0.010	<0.010	< 0.010	<0.010	<0.010	
MW-22B	Upgradient-OS	<0.010	<0.0070	<0.0050	<0.0050	<0.0050		<0.010	<0.010	<0.010	<0.010	<0.010	
Residential Wells	[6												
1001		,						,	'	-	,	-	
D03						-		,		,			
1)()4		-			•			'		,		-	!
D05					•			•	'	•	-	•	
D09		-	-	•	,	-		-		-	٠		
D15		-		•	,			-			٠	-	

- Table includes only those parameters that were detected in at least one sample.

All values are expressed in units of parts per million (ppm.mg/L).

Shaded values exceed the Action Level (MCL).

 $-A^{-1/2}$ indicates that either monitoring well was not sampled or parameter was not tested for. $-A^{-1/2}$ indicates that the parameter was not detected above the Method Detection Limit (MDL).

'Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site. The associated value is the Reporting Limit (RL).

Pirst value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

. E E		1		<0.0030 <0.0030 <0.0030 <0.0030	<0.0030	<0.0030 <0.0030 <0.0030 <0.0030	<0.00030 <0.0030		<0.0030 <0.0030 <0.0030 <0.0030	<0.0030	<0.0030	<0.0030 <0.0040 <0.0040	<0.0040 <0.0030 <0.0040	080000	060000	00000	Su.Wad		<0.0020 <0.0030 <0.0030 <0.0030								
	1st Round 2nd	╁	+	<0.020	▼ -	<0.020	-	-	<0.020	<0.020	\vdash	<0.020	L	F	╁	+	+	4	<0.020 <0			'	1				
	Action Level	╈	1																								-
	5th Round		0,000	SU:0050		<0.0050	<0.0050	<0.0050	<0.0050	<0.0050		<0.0050	<0.0050	<0.0050	<0.0050		0.000	20:00:0	<0.0050				•				
	4th Round		0300	0c00:0>		<0.0050	<0.0050		<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	,	02000	00000	<0.0050						-		
Island	3rd Round		03000	20.000	,	<0.0050	<0.0050		<0.0050	<0.0050	,	<0.0050	<0.0050	<0.0050	<0.0050	05000>	03000	0.0000	0500.0>			,	•	,			
	2nd Round		03000	00000	<0.0050	<0.0050	<0.0050		<0.0050	<0.0050		<0.0050	<0.0050	<0.0050	<0.0050	,	05000	00000	20.0050			1		•	٠		
	1st Round		<0.0050	2000		<0.0050	<0.0050		<0.0050	<0.0050	,	<0.0050	<0.0050	<0.0050	< 0.0050		V 00 00 0	050007	COCOC						•		
Relative1	Location	9	V. Inoradicat.	I language M	Oppragnent	Upgradient-N	Sidegradient-N	Sidegradient-N	Sidegradient-N	Sidegradient-N	Sidegradient-N	Sidegradient-N	Sidegradient-N	Downgradient	Downgradient	Downgradient	Uppradient-OS	Thursday Oc	Opprimental Co.								
Well	Œ	Monitoring Wells	MW-13A	MW.134D.m	dnow con	MW-15B	MW-15A	MW-15ADup	NIW-15B	MW-16	MW-1615up	MW-17A	MW-17B	MW-18A	MW-18B	MW-18BDup	MW-22A	Mrw. 22R		Residential Wells	DOI	1)03	200	100	Soci	1009	

· Table includes only those parameters that were detected in at least one sample.

- All values are expressed in units of parts per million (ppm,mg/L).

• Shaded values exceed the Action Level (MCL).

A "-" indicates that either monitoring well was not sampled or parameter was not tested for.

A "<" indicates that the parameter was no. detected above the Method Detection Limit (MDL).

The associated value is the Reporting Limit (RL).

'I ocation of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

Pirst value represents initial exceedance/Second value represents confirmation sampling result.

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relative			Cobalt					Copper		
Ω,	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	ls										
MW-13A	Upgradient-N	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-13ADup	Upgradient-N	-	<0.0050					<0.010	,	,	,
MW-13B	Upgradie1.t-N	<0.0050	<0.0050	<0.0050	<0.0050	< 0.0010	< 0.010	0.0114	<0.010	<0.010	<0.010
MW-15A	Sidegradient-N	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	< 0.010	<0.010	<0.010	<0.010	<0.010
MW-15ADup	Sidegradient-N	•				< 0.0010					<0.010
MW-15B	Sidegradient-N	<0.0050	<0.0050	<0.0050	<0.0050	< 0.0010	< 0.010	<0.010	<0.010	<0.010	<0.010
MW-16	Sidegradient-N	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	< 0.010	<0.010	<0.010	<0.010	<0.010
MW-16Dup	Sidegradient-N	•	,		<0.0050	,	,			<0.010	
MW-17A	Sidegradient-N	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	0.0469	0.0116	<0.010	<0.010
MW-17B	Sidegradient-N	<0.0050	<0.0050	<0.0050	<0.0050	< 0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-18A	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	< 0.010	0.0102	0.0156	<0.010	<0.010
MW-18B	Downgradient	<0.0050	<0.0050	<0.0050	<0.0050	< 0.0010	<0.010	<0.010	<0.010	<0.010	<0.010
MW-18BDup	Downgradient			<0.0050					<0.010	,	
MW-22A	Upgradient-OS	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	<0.010	0.0152	<0.010	<0.010	<0.010
MW: 22B	Upgradient-OS	<0.0050	<0.0050	<0.0050	<0.0050	<0.0010	< 0.010	<0.010	<0.010	<0.010	<0.010
Residential Wells	S										
D01											
D03				,		,					
D04							-				,
D05			-		-	-	-	-			
D09		-	•	-		•		-		,	
D15		,		•	•	-	-				

Tuble includes only those parameters that were detected in at least one sample.
All values are expressed in units of parts per million (ppm;mg/L).
Shaded values exceed the Action Level (MCL).
A "" indicates that either monitoning well was not sampled or parameter was not tested for.
A "
A " indicates that the parameter was not detected above the Method Detection Limit (MDL).
The associated value is the Reporting Limit (RL).

1, ocation of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

²First value represents initial exceedance/Second value represents confirmation sampling result.

11 133

QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

/X/	Palativa										
				Iron					Manganese		
a	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	lls										
MW-13A	Upgradient-N	1.7	0.899	0.643	1.17	0.52	0.168	0.154	0.159	0.186	0.162
MW-13ADup	Upgradient-N	-	0.797					0.152			
MW-13B	Upgradient-N	2	2.56	1.14	0.918	0.377	0.162	0.164	0.176	0.173	0.193
MW-15A	Sidegradient-N	1.67	0.605	1.03	0.582	0.551	0.147	0.138	0.137	0.164	0.152
MW-15ADup	Sidegradient-N	,	•			0.519					0.142
MW-15B	Sidegradient-N	0.577	0.484	0.46	0.915	0.634	0.129	0.116	0.119	0.163	0.127
MW-16	Sidegradient-N	2.66	2.5	2.27	3.50	1.75	0.246	0.227	0.212	0.258	0.191
MW-16Dup	Sidegradient-N	·		-	3.22					0.256	
MW-17A	Sidegradient-N	1.91	1.85	1.91	2.30	2.26	0.109	0.104	0.122	0.154	0.144
MW-17B	Sidegradient-N	0.811	0.625	0.641	0.484	1.14	<0.050	<0.050	<0.050	0.0716	0.0725
MW-18A	Downgradient	1.59	1.58	2.29	1.27	1.23	0.085	0.103	0.178	0.168	0.127
MW-18B	Downgradient	0.518	0.372	0.651	0.455	0.331	<0.050	<0.050	<0.050	<0.050	0.0364
MW-18BDup	Downgradient	,		0.874				,	<0.050		
MW-22A	Upgradient OS	1.65	9.24	0.509	0.638	0.635	0.169	0.312	0.18	0.200	0.177
MW-22B	Upgradient-OS	0.414	0.326	0.357	0.195	0.500	0.104	0.0998	0.11	9660'0	0.117
Residential Wells	8										
D01		0.313				0.301	<0.050				0.0356
D03		0.467				0.369	<0.050				0.0323
D04		2.49	,			0.728	0.0634				0.0708
D05		<0.050				0.0262	<0.050			,	<0.0050
D09		0.672	,				0.0597	,			
D15		0.455	-	-	,	0.489	<0.050		,		0.0452

- Table includes only those parameters that were detected in at least one sample. All values are expressed in units of parts per million (ppm,rng/L). Shaded values exceed the Action Level (MCL).
- A "" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

 $^2 \mathrm{First}$ value represents initial exceedance/Second value represents confirmation sampling result.

¹Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relative1			Sodium					Zinc		
ID	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	al										
MW-13A	Upgradient-N	7.37	8.21	7.47	7.63	7.19	<0.050	<0.020	<0.020	<0.020	<0.0050
MW-13ADup	Upgradient-N	•	8.09		-	•		<0.020			
MW-13B	Upgradient-N	8.89	9.62	8.49	8.01	89.8	<0.050	<0.020	<0.020	<0.020	0.00666
MW-15A	Sidegradient-N	11.8	13.7	10.6	11.1	10.5	<0.050	<0.020	<0.020	<0.020	<0.0050
MW-15ADup	Sidegradient-N	•	•	•	•	69.6	•	•			<0.0050
MW-15B	Sidegradient-N	10.8	13	10.9	11.3	11.1	0.0626	<0.020	<0.020	<0.020	<0.0050
MW-16	Sidegradient-N	41.3	43.1	36.8	45.4	47.3	<0.050	<0.020	<0.020	<0.020	<0.0050
MW:16Dup	Sidegradient-N		-		44.3	•		1	-	<0.020	
MW-17A	Sidegradient-N	28.3	32.4	31	38.2	38.1	<0.050	<0.020	<0.020	<0.020	<0.0050
MW-17B	Sidegradient-N	28.4	31.4	30.1	32.6	31.8	< 0.050	<0.020	<0.020	<0.020	<0.0050
MW-18A	Downgradient	53	4:09	58.4	58.9	54.9	<0.020	<0.020	<0.020	<0.020	<0.0050
MW-18B	Downgradient	8.86	101	94.6	2.96	87.7	<0.020	<0.020	<0.020	< 0.020	<0.0050
MW-18BDup	Downgradient			7.56	•	•			<0.020	•	,
MW-22A	Upgradient-OS	8.82	86.8	7.9	8.84	7.38	<0.050	0.0365	<0.020	<0.020	0.00515
MW 22B	Upgradient-OS	11.6	11.3	11.8	11.6	9.91	<0.050	<0.020	<0.020	<0.020	<0.0050
Residential Wells	8										
D01		8.96	,	_		98.6		·		,	
D03		51.4	•			60.2		,	-		-
1004		78.7	,			7.99		,		,	
D05		125	,		•	129	•				
D09		11.7	-	-	-	,		,		,	-
1015		19.8		-	,	21.2	•	-			,

- Table includes only those parameters that were detected in at least one sample.

 All values are expressed in units of parts per million (ppm.mg/L).

 Shaded values exceed the Action Level (MCL).
- A "-" indicates that either monitoning well was not sampled or parameter was not tested for A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 - The associated value is the Reporting Limit (RL).

'I.ocunon of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

Prist value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

	Chloride	ande					Sulfate		
1st Round 2nd Round 3rd Round	ğl	\dashv	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
25.1 8.75 24.5	5		22.5	20.7	56.4	25.7	55.3	52.2	6.69
20.3				-		52.5			
24.2 20.2 21		21.6	22.0	22.2	54.4	49.4	54.7	51.1	67.4
32.6 25	24.7	7	20.1	19.6	50.1	39.8	49.2	52.4	40.2
,	,			19.1					39.4
44.7 21.7	33.4	4	29.2	23.8	21.2	22.8	31.4	7.22	30.9
83.2 72	113	3	95.9	94.6	134	74.4	8.44	50.3	92.5
			87.2	-	,			45.1	
46.2 50.2	81.5	.5	9.62	78.9	57.1	%	72.2	9:99	69.3
69 61.9	89.2	.2	65.7	49.9	38.1	34	40	36.9	30.4
34.9 32.8	49.5	5	45.3	26.0	69.4	76.7	114	71.3	102
46.8 34.5	44.8	8.	35.0	34.3	0.257	0.413	<1.0	<0.10	0.135
	42.5	.5	-		,	,	1.3		ì
28.4 16.4	33.4	4.	29.2	27.9	77.6	50.3	65.9	54.0	68.1
8.79 9.12	10.8	8.	10.2	9.32	31.9	32.2	34.1	32.4	42.0
	- 1								
75.6	l ·			19.7	0.252				10.9
8.49	۱ ۰			12.8	8.35				7.22
4.79	•		-	4.43	19.3				35.4
11.5	١.		-	10.5	13.9				28.8
3.59				-	12.8				,
4.04		_		214	105				200

- Table includes only those parameters that were detected in at least one sample.
 - All values are expressed in units of parts per milion (ppm,mg/L). Shaded values exceed the Action Level (MCL).
- A "." indicates that either monitoring well was not sampled or parameter was not tested for A "c" indicates that the parameter was not detected above the Method Detection Limit (MDL),

The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

²First value represents mital exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

REPORTING PERIOD: AUGUST - OCTOBER 2002

Well	Relative ¹			Ammonia				Ž	Nitrate-Nitrite (as N)	2	
CII	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Monitoring Wells	Us										
MW-13A	Upgradient-N	<0.20	<0.20	0.34	<0.20	<0.20	<0.328	<0.0530	<0.05	0.380	<0.053
MW-13ADup	Upgradient-N		<0.20		-			<0.0530	,		
MW-13B	Upgradient-N	<0.20	0.22	<0.20	0.39	<0.20	<0.328	< 0.0530	<0.05	<0.053	<0.053
MW-15A	Sidegradient-N	<0.20	0.22	0.34	<0.20	<0.20	<0.328	<0.0530	<0.05	<0.053	<0.053
MW-15ADup	Sidegradient-N	_	•			<0.20	•	•	,	,	<0.053
MW-15B	Sidegradient-N	0.22	0.34	0.8	<0.20	0.28	<0.328	<0.0530	<0.05	<0.053	<0.053
MW-16	Sidegradient-N	0.45	0.56	0.45	<0.20	<0.20	<0.328	<0.0530	<0.05	<0.053	<0.053
MW-16Dup	Sidegradient-N	-	•		05:0		•		,	<0.05	
MW-17A	Sidegradient-N	<0.20	19.0	<0.20	1.1	<0.20	<0.328	<0.0530	<0.05	<0.053	<0.053
MW-17B	Sidegradient-N	0.28	0.78	<0.20	0.62	<0.20	<0.328	0.0628	<0.05	<0.053	<0.53
MW-18A	Downgradient	0.56	0.56	0.78	0.22	<0.20	<0.327	3	0.315	<0.053	<0.053
MW-18B	Downgradient	1	<0.20	0.56	0.22	0.22	<0.327	<0.0530	<0.05	<0.053	<0.053
MW-18BDup	Downgradient		•	0.22			•	,	<0.05		
MW-22A	Upgradient-OS	< 0.20	0.34	<0.20	0.50	<0.20	<0.328	<0.0530	<0.05	<0.053	<0.053
MW-22B	Upgradient-OS	<0.20	< 0.20	0.22	0.50	<0.20	<0.328	<0.0530	<0.05	<0.053	<0.053
Residential Wells	ls										
D01		<0.20				0.22	<0.328	-			<0.053
D03		0.22	-	_	-	0.3900	<0.327	•			<0.053
D04		0.22		_		<0.20	<0.327				<0.053
D05		0.22			-	<0.20	<0.053	-	-	,	<0.053
D09		0.22	•				<0.327				,
D15		0.34	-		-	<0.20	<0.327				<0.053

Table includes only those parameters that were detected in at least one sample.
All values are expressed in units of parts per million (ppm,mg/1).
Shaded values exceed the Action Level (MCL).
A "" indicates that either monitioning well was not sampled or parameter was not tested for.
A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
The associated value is the Reporting Limit (RL).

Location of well relative to groundwater flow direction. N=north; S=south; OS=off:site.

Prist value represents initial exceedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

nmq lst												
Location 1st Round 2nd Round 3rd Round 4th Round 5th Round 1st Round 3rd Round Upgradient-N 400 330 340 360 11 13 <10 Upgradient-N 380 350 340 360 350 14 10 <10 Upgradient-N 380 360 300 340 360 14 <10 <10 Sidegradient-N 460 350 320 100* 350 14 <10 <10 Sidegradient-N 400 350 530 530 16 11 <10 Sidegradient-N 400 350 530 530 16 11 <10 Sidegradient-N 500 540 550 550 550 16 11 <10 Sidegradient-N 500 540 550 550 550 540 <10 <10 Sidegradient-N 500 540 400 400 5	Well	Kelanve			TDS					COD		
Upgradient-N 400 340 360 340 11 13 <10	9	Location	1st Round	2nd Round	3rd Round	4th Round	5th Round	1st Round	2nd Round	3rd Round	4th Round	5th Round
Upgradient-N 400 330 340 360 340 11 13 <10 Upgradient-N 380 370 340 360 14 10 10 Sidegradient-N 460 360 300 340 290 14 <10	oring Wel	ls.										
Upgradient-N 380 350 360 350 18 11 <10 Upgradient-N 460 360 360 350 14 <10	3A	Upgradient-N	400	330	£	360	340	=	13	<10	×10	<10
Upgradient-N 380 350 340 360 360 360 360 360 360 360 360 370 14 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <th< td=""><td>3АДир</td><td>Upgradient-N</td><td></td><td>370</td><td></td><td>-</td><td></td><td></td><td>10</td><td>,</td><td>,</td><td></td></th<>	3АДир	Upgradient-N		370		-			10	,	,	
Sidegradient-N 460 360 340 290 14 <10 <10 Sidegradient-N 400 300 320 100* 340 - <	38	Upgradient-N	380	350	340	360	350	18	11	<10	<10	22
Sidegradient-N 400 320 100* 330 13 12 <10 Sidegradient-N 640 550 530 530 16 11 <10	5A	Sidegradient-N	460	360	300	340	290	14	<10	<10	×10	<10
Sidegradient-N 400 300 320 100* 330 100* 11 <10 Sidegradient-N 640 550 530 530 530 10 <10	5AIJup	Sidegradient-N	•		-	,	340	1				<10
Sidegradient-N 640 550 530 530 11 <10 Sidegradient-N 500 430 530 520 22 10 <10	SB	Sidegradient-N	400	300	320	100*	330	13	12	<10	<10	<10
Sidegradient-N 540 520 520 22 10 Sidegradient-N 530 440 440 400 24 <10	9	Sidegradient-N	640	550	530	530	530	16	=	<10	<10	\$10 \$10
Sidegradient-N 530 530 520 520 22 10 <10 Sidegradient-N 530 420 440 400 24 <10	6Dup	Sidegradient-N		-	,	540					×10	
Sidegradient-N 530 420 440 400 24 <10 <10 Downgradient 390 350 350 330 <10	7.A	Sidegradient-N	200	430	530	520	520	22	10	×10	×10	<10 C10
Downgradient 500 540 560 550 330 <10 10 <10 Downgradient 390 350 350 360	7.18	Sidegradient-N	530	420	440	440	004	24	<10	<10	<10	<10
Downgradient 390 350 350 340 410 <t< td=""><td>8A</td><td>Downgradient</td><td>200</td><td>540</td><td>260</td><td>550</td><td>330</td><td><10</td><td>10</td><td><10</td><td><10</td><td><10</td></t<>	8A	Downgradient	200	540	260	550	330	<10	10	<10	<10	<10
Downgradient 360 360 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - < 10 - - - - - - - - - - - - - - - - - - -	88	Downgradient	390	350	350	330	340	<10	10	<10	√ 10	1=
Upgradient-OS 380 340 370 360 410 11 <10 Upgradient-OS 300 260 300 300 16 10 <10	3BDup	Downgradient			360			,		<10		
Upgradient OS 300 300 300 10 10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <10 <th< td=""><td>×.</td><td>Upgradient-OS</td><td>380</td><td>340</td><td>390</td><td>370</td><td>360</td><td><10</td><td>=</td><td>×10</td><td><10</td><td><10</td></th<>	×.	Upgradient-OS	380	340	390	370	360	<10	=	×10	<10	<10
420 410 310 300 270 250 300 330 300 330	13	Upgradient-OS	300	260	300	300	310	16	10	<10	<10	01>
420 410 310 300 270 250 300 330 270 330 300 330 300 330 300 330 300 330												
410 300 300 250 330	ntial Well:	6										
300 300 250 250 330 290 290			420			,	410	11			,	×10
250 330			310				300	<10			,	<10
330			270	•		,	250	<10			,	<10
230			300	-		,	330	<10			,	<10
			270	·		-		<10			,	-
			300				290	15				<10

<sup>Table includes only those parameters that were detected in at least one sample.
All values are expressed in units of parts per million (pprinting/L).
Shaded values exceed the Action Level (MCL).
A "." indicates that either monitoring well was not sampled or parameter was not tested for.
A "<" indicates that the parameter was not detected above the Method Detection Limit (MDL).
The associated value is the Reporting Limit (RL).</sup>

Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

 $^{^2}F$ ust value represents unital execedance/Second value represents confirmation sampling result.



QUARTERLY REPORT LONG-TERM GROUNDWATER MONITORING PROGRAM

NEW LYME LANDFILL SUPERFUND SITE, NEW LYME, OHIO

Well	Relative ¹	Bis(2	Bis(2-Ethylhexyl)phthalate	alate	Diethyl Phthalate
Ω	Location	4th Round	5th Round	Action Level	5th Round
Monitoring Wells	8				
MW-13A	Upgradient-N	< 0.010	< 0.010		<0.010
MW-13ADup	Upgradient-N	-	•		_
MW-13B	Upgradient-N	< 0.010	<0.010		<0.010
MW-15A	Sidegradient-N	< 0.010	<0.010		0.280
MW-15ADup	Sidegradient-N		< 0.010		<0.010
MW-15B	Sidegradient-N	<0.010	< 0.010		<0.010
MW-16	Sidegradient-N	<0.010	<0.010		<0.010
MW-16Dup	Sidegradient-N	<0.010	1		
MW-17A	N-traibergabis	<0.010	<0.010		<0.010
MW-17B	Sidegradient-N	<0.010	<0.010		<0.010
WW-18A	Downgradient	<0.010	<0.010		< 0.010
MW-18B	Downgradient	<0.010	<0.010		<0.010
MW-18BDup	Downgradient	,	,		,
MW-22A	Upgradient-OS	< 0.010	<0.010		< 0.010
MW-22B	Upgradient-OS	<0.010	<0.010		<0.010
Residential Wells	8				
D01		-	•		•
£0CI		-	•	•	_
D04		_		-	,
D05		-		-	
D09		-			
D15		·	•	•	

- Table includes only those parameters that were detected in at least one sample.
 All values are expressed in units of parts per million (ppmung/L).
 Shaded values exceed the Action Level (MCL).

- A "-" indicates that either monitoring well was not sampled or parameter was not tested for.
 A "-" indicates that the parameter was not detected above the Method Detection Limit (MDL).
 The associated value is the Reporting Limit (RL).

^{&#}x27;Location of well relative to groundwater flow direction. N=north; S=south; OS=off-site.

Pirst value represents initial exceedance/Second value represents confirmation sampling result.

Attachment A

Site Inspection Sheets / Questionnaires

Please note that "O&M" is referred to throughout this checklist. At sites where Long-Term Response Actions are in progress, O&M activities may be referred to as "system operations" since these sites are not considered to be in the O&M phase while being remediated under the Superfund program.

Five-Year Review Site Inspection Checklist (Template)

(Working document for site inspection. Information may be completed by hand and attached to the Five-Year Review report as supporting documentation of site status. "N/A" refers to "not applicable.")

I. SITE INF	ORMATION
Site name: New Lyne	Date of inspection: 10/34/03
Location and Region: Ashtabula Co., OHTO	EPAID: 0HO 980 794 614
Agency, office, or company leading the five-year review: U.S.E.M. J. K. C.E. F.A.	Weather/temperature: Morania 30 F Actly Cloudy voyly
G Access controls	Monitored natural attenuation Groundwater containment Vertical barrier walls
Attachments: Inspection team roster attached	
II. INTERVIEWS	
Name Interviewed G at site G at office G by phone Phone Problems, suggestions; G Report attached	Title Date
2. O&M staffName	
Name Interviewed G at site G at office G by phone Phon Problems, suggestions; G Report attached	Title Date e no.

Demny Brock - B(- Site Manager Mike Watkiss - BC - Project Manager Andrew Kocher - OEPA D-7

OSWER No. 9355.7-03B-P

Agency ONR Contact Ken Name Problems: suggestions (3 Report attached)	Arey Manue - Previous	1/7/17	(470675
Name Problems; suggestions Report attached	Titlé		
Agency			
Name Problems; suggestions; G Report attached	litle	Date	Phone
Agency			
Name Problems; suggestions; G Report attached	Title	Date	Phone
Agency			
Name Problems; suggestions; G Report attached	Title	Date	Phone
Other interviews (optional) G Report attach	ned.	•	,
	-		
,			

	III. ON-SITE DOCUMENTS &	RECORDS VERIFIED (C	heck all that app	ly)
1.	O&M Documents G O&M manual Sicerca G As-built drawings Since G Maintenance logs Since Remarks BC will binear youth	G Readily available G Readily available G Readily available G Readily available Late discurrent: With	G Up to date G Up to date G Up to date G Up to date	G N/A G N/A G N/A 4 //4/ / 4_,
2.	Site-Specific Health and Safety Plan G Contingency plan/emergency response Remarks		G Up to date G Up to date	G N/A G N/A
3.	O&M and OSHA Training Records Remarks 100	G Readily available	G Up to date	G N/A
4.	Permits and Service Agreements G Air discharge permit G Effluent discharge G Waste disposal, POTW G Other permits Remarks	G Readily available G Readily available G Readily available G Readily available	G Up to date	Ø N/A Ø N/A Ø N/A Ø N/A
5.	Gas Generation Records G Recentaries	adily available G Up to	date (GN/A	A
6.	Settlement Monument Records Remarks	G Readily available	G Up to date	ØN/A
7.	Groundwater Monitoring Records Remarks Not Necessary	G Readily available	G Up to date	₫N/A
8.	Leachate Extraction Records Remarks	G Readily available	G Up to date	©N/A
9.	Discharge Compliance Records G Air G Water (effluent) Remarks	G Readily available G Readily available	G Up to date G Up to date	Ø N/A → N/A
10.	Daily Access/Security Logs Remarks & will keep fun in Market - Just (help)	G Readily available sign out log work an	G Up to date	GN/A Sik

	IV. O&M COSTS
1.	O&M Organization G State in-house G Contractor for State G PRP in-house G Contractor for PRP G Federal Facility in-house G Contractor for Federal Facility G Other
2.	O&M Cost Records G Readily available G Up to date G Funding mechanism/agreement in place Original O&M cost estimateG Breakdown attached
	Total annual cost by year for review period if available From 200 / To 2002
3.	Unanticipated or Unusually High O&M Costs During Review Period Describe costs and reasons:
	V. ACCESS AND INSTITUTIONAL CONTROLS G Applicable G N/A
A. F	encing
1.	Fencing damaged G Location shown on site map G Gates secured G N/A Remarks France was repaired use G locatellings
В. О	ther Access Restrictions
1.	Signs and other security measures G Location shown on site map G N/A Remarks Adjuste Quanty of Wis Najarry & Signs were fut up also vite unit

1.	Implementation and enforcement Site conditions imply ICs not properly implemented Site conditions imply ICs not being fully enforced G Yes © No N/A Site conditions imply ICs not being fully enforced
	Site conditions imply ICs not being fully enforced G Yes G No MA Type of monitoring (e.g., self-reporting, five by
	Type of monitoring (e.g., sen repermis)
	Frequency beekly
	Responsible party/agency BC Contact Condit Breck Title Date Phone no.
	Name
	Yes G No G N/A
	Reporting is up-to-date G Yes SNo G N/A
	Reports are verified by the lead agency
	Reports are verified by the lead agency Note: Reports will he leading in mothly reports Specific requirements in deed or decision documents have been met G Yes G No G N/A G Yes G No G N/A
	Specific requirements in deed or decision documents have been met
	Violations have been reported
	Other problems or suggestions: G Report attached
2.	Adequacy G ICs are adequate G ICs are inadequate G N/A Remarks_
<u> </u>	Adequacy (3) ICs are adequate G ICs are madequate Remarks
<u> </u>	Adequacy Remarks General Vandalism/trespassing G Location shown on site map GNo vandalism evident
D. (Adequacy () ICs are adequate G ICs are madequate Remarks
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Remarks
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Remarks
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Land use changes on site SAR
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Remarks
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Land use changes on site S NA Remarks
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map GNo vandalism evident Remarks Land use changes on site NA Remarks Land use changes off steg NA
D. 6	Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Land use changes on site S NA Remarks
D. 6	Adequacy Remarks General Vandalism/trespassing G Location shown on site map GNo vandalism evident Remarks Land use changes on site NA Remarks Land use changes off steg NA
D. (Adequacy Remarks General Vandalism/trespassing G Location shown on site map Remarks Land use changes on site S NA Remarks Land use changes off skeG N/A Remarks

B. O	ther Site Conditions
	Remarks
	VII. LANDFILL COVERS G Applicable G N/A
1.	Settlement (Low spots) Areal extent Remarks A feb location shown on site map G Settlement not evident Depth Remarks A feb location shown on site map G Settlement not evident Depth Remarks A feb location shown on site map G Settlement not evident Depth Remarks A feb of the contained remarks A feb of th
2.	Cracks G Location shown on site map Cracking not evident Lengths Remarks
3.	Erosion G Location shown on site map © Erosion not evident Areal extent Depth Remarks
4.	Holes G Location shown on site map G Holes not evident Areal extent / 2 deapte Depth 1-2 feet Remarks / few small holes, may be about found ground holes
5.	Vegetative Cover Grass G Cover properly established G No signs of stress G Trees/Shrups (indicate size and locations on a diagram) Remarks A few specifical fields well reason for the specific of fields well reason for the specific of fields and fields well reason for the specific of fields and fields are supported to the second fields and fields and fields and fields and fields and fields and fields are supported to the second fields and fields and fields and fields are supported to the second fields and fields and fields are supported to the second fields are supported to the sec
6.	Alternative Cover (armored rock, concrete, etc.) CN/A Remarks
7.	Bulges G Location shown on site map G Bulges not evident Areal extent Height Remarks

8. 2	Wet Areas/Water Damage G Wet areas Ponding G Seeps G Soft subgrade Remarks Slope Instability Areal extent Remarks	G Wet areas/water damage not ev G Location shown on site map	Areal extentAreal extentAreal extentAreal extentAreal extent
B. Ber	(Horizontally constructed mou in order to slow down the velo channel.)	nds of earth placed across a steep land city of surface runoff and intercept and	Convey the raner of the
1.	Flows Bypass Bench Remarks	G Location shown on site map	G,N/A or okay
2.	Bench Breached G I Remarks	Location shown on site map	GN/A or okay
3.	Bench Overtopped Remarks	G Location shown on site map	©N/A or okay
C. Le	etdown Channels G Applicab (Channel lined with erosion c side slope of the cover and w landfill cover without creatin	ill allow the runoff water collected by	ions that descend down the steep the benches to move off of the
1.			o evidence of settlement
2.	Material Degradation G Material type Remarks	Location shown on site map Areal extent	lo evidence of degradation
3.	Areal extent	Location shown on site map Depth Flare grown with the first control of the cont	

4.	Undercutting G Location shown on site map GNo evidence of undercutting Areal extent Depth Remarks
5.	Obstructions Type
6.	Excessive Vegetative Growth Solve No evidence of excessive growth Government Vegetation in channels does not obstruct flow Government Location shown on site map Remarks
D. C	Cover Penetrations G Applicable G N/A
1.	Gas Vents G Properly secured/lockedG Functioning G Routinely sampled Good condition G Evidence of leakage at penetration G N/A Remarks Solution G Needs Maintenance G N/A Remarks Solution G Needs Maintenance G N/A Remarks Solution G Needs Maintenance
2.	Gas Monitoring Probes G Properly secured/lockedG Functioning G Routinely sampled G Good condition G Evidence of leakage at penetration G Needs Maintenance GN/A Remarks
3.	Monitoring Wells (within surface area of landfill) G Properly secured/lockedG Functioning G Routinely sampled G Good condition G Evidence of leakage at penetration G Needs Maintenance G N/A Remarks
4.	Leachate Extraction Wells G Properly secured/locked G Functioning G Routinely sampled G Good condition G Evidence of leakage at penetration G Needs Maintenance GN/A Remarks Extraction Funding will have been from the first about the formula about the first and the first about the fir
5.	Settlement Monuments G Located G Routinely surveyed GNA Remarks

E. Gas	E. Gas Collection and Treatment G Applicable GN/A		
1.	Gas Treatment Facilities G Flaring G Good condition Remarks	G Thermal destruction G Collection for reuse G Needs Maintenance	
2.	Gas Collection Wells, M G Good condition Remarks	anifolds and Piping G Needs Maintenance	
3.	Gas Monitoring Facilitie G Good condition Remarks	es (e.g., gas monitoring of adjacent homes or buildings) G Needs Maintenance G N/A	
F. Cov	er Drainage Layer	G Applicable GN/A	
1.	Outlet Pipes Inspected Remarks	G Functioning G N/A	
2.	Outlet Rock Inspected Remarks	G Functioning G N/A	
G. De	tention/Sedimentation Po	nds G Applicable GN/A	
1.	Siltation Areal extent G Siltation not evident Remarks		
2.	Erosion Areal G Erosion not evident Remarks	extent Depth	
3.	Outlet Works Remarks		
4.	Dam Remarks	G Functioning G N/A	


H. R	etaining Walls	G Applicable G N/A
1.	Deformations Horizontal displacement Rotational displacement Remarks	Vertical displacement
2.	Degradation Remarks	G Location shown on site map G Degradation not evident
I. Pe	rimeter Ditches/Off-Site l	Discharge GApplicable G N/A
1.	Areal extent	cation shown on site mag © Siltation not evident Depth
2.	Vegetation does not Areal extent	G Location shown on site map G N/A impede flow Type
3.	Erosion Areal extentRemarks	G Location shown on site map G Erosion not evident Depth
4.	Discharge Structure Remarks	G Functioning GN/A
	VIII. VI	ERTICAL BARRIER WALLS G Applicable GN/A
1.	Settlement Areal extent	G Location shown on site map G Settlement not evident Depth ,
2.	G Performance not me Frequency Head differential	ringType of monitoring onitored G Evidence of breaching

	IX. GROUNDWATER/SURFACE WATER REMEDIES (Applicable G N/A
Gı	roundwater Extraction Wells, Pumps, and Pipelines GApplicable G N/A
	Pumps, Wellhead Plumbing, and Electrical Good condition G All required wells properly operating G Needs Maintenance G N/A Remarks Frederic for the feeding for short for the feeding for monthly Checked but Instruct the first for monthly
	Extraction System Pipelines, Valves, Valve Boxes, and Other Appurtenances G Good condition G Needs Maintenance Remarks
	Spare Parts and Equipment G Readily available G Good condition G Requires upgrade G Needs to be provided Remarks
-	Surface Water Collection Structures, Pumps, and Pipelines G Applicable GN/A
_	Collection Structures, Pumps, and Electrical G Good condition G Needs Maintenance Remarks
	Surface Water Collection System Pipelines, Valves, Valve Boxes, and Other Appurtenances G Good condition G Needs Maintenance Remarks
	Spare Parts and Equipment G. Good condition G. Requires upgrade G. Needs to be provided

C. Tre	tment System G Applicable GNA Sista, temperarty off line
1.	Treatment Train (Check components that apply) G Metals removal G Oil/water separation G Bioremediation G Air stripping G Carbon adsorbers G Filters
2.	Electrical Enclosures and Panels (properly rated and functional) G N/A G Good condition G Needs Maintenance Remarks
3.	Tanks, Vaults, Storage Vessels G N/A G Good condition G Proper secondary containment G Needs Maintenance Remarks
4.	Discharge Structure and Appurtenances G N/A G Good condition G Needs Maintenance Remarks
5.	Treatment Building(s) G N/A G Good condition (esp. roof and doorways) G Needs repair G Chemicals and equipment properly stored Remarks
6.	Monitoring Wells (pump and treatment remedy) G Properly secured/lockedG Functioning G Routinely sampled G Good condition G All required wells located G Needs Maintenance G N/A Remarks
D. Mo	altoring Data
1.	Monitoring Data G is routinely submitted on time G is of acceptable quality
2.	Monitoring data suggests: Perinctor bells not exceeding Incl with lay Groundwater plume is effectively contained G Contaminant concentrations are declining

D.	Monitored Natural Attenuation
1.	Monitoring Wells (natural attenuation remedy) Properly secured/locked Functioning & Routinely sampled & Good condition G All required wells located G Needs Maintenance G N/A Remarks Che Conchest Recure Conchest Conchest
	X. OTHER REMEDIES
	If there are remedies applied at the site which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.
	XI. OVERALL OBSERVATIONS
 A.	Implementation of the Remedy
	Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emission, etc.). Affective remedy - frankfull capt trained attenuate. Yer, remove a lifetime and functioning - mp afford with my always.
В	. Adequacy of O&M
	Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy. The procedure is to the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy. Procedure is the current and long-term protectiveness of the remedy.

Early Indicators of Potential Remedy Problems
Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs, that suggest that the protectiveness of the remedy may be compromised in the future.
 Opportunities for Optimization
 Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy. Shylting flood days Continue markeying and observative gramparlanes and Yeshia ferraring flood walls manufaced ashelps inquings at sayling, and for continuent monitoring for

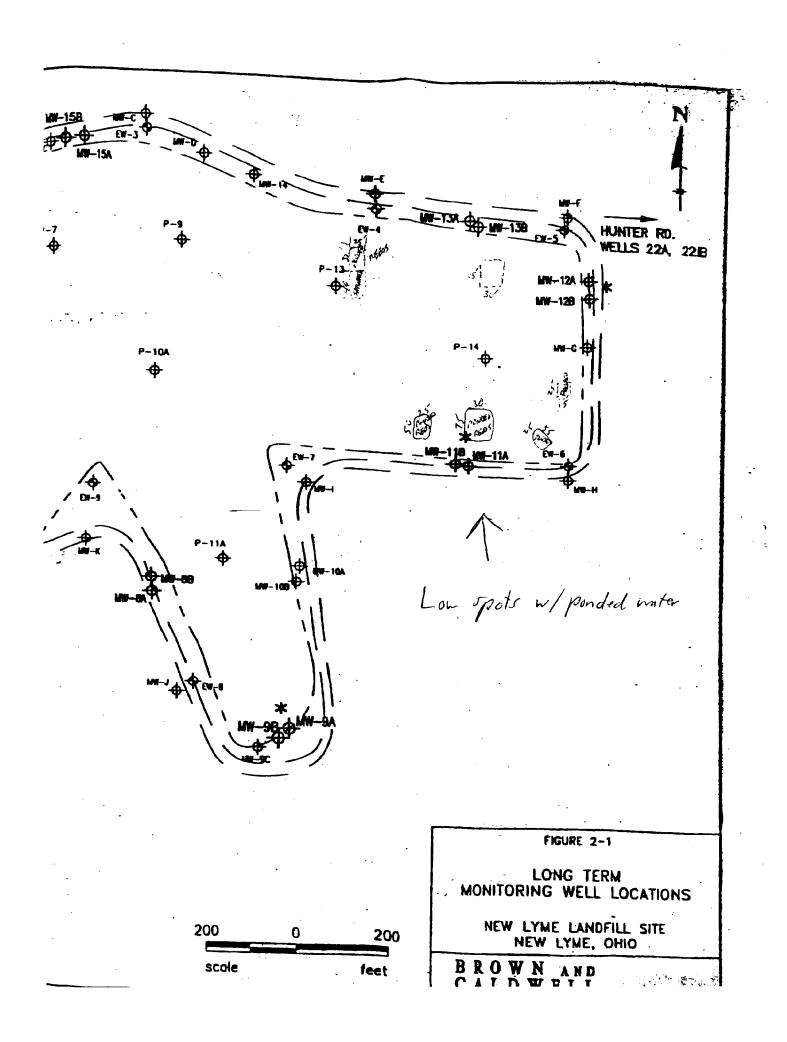

ChieEPA State of Ohio Environmental Protection Agency

Northeast District Office

2110 E. Aurora Road Twinsburg, Ohio 44087-1969

TELE (330) 425-9171 FAX (330) 487-0769

Bob Taft, Governor Christopher Jones, Director

October 24, 2002

RE:

NEW LYME LANDFILL ASHTABULA COUNTY

OHIO EPA ID # 204-0559

Resident / Owner New Lyme, Ohio 44066 FIVE-YEAR REVIEW INTERVIEW

Dear Resident / Owner:

The Ohio Environmental Protection Agency (Ohio EPA), in cooperation with the United States Environmental Protection Agency (U.S. EPA), is conducting a five-year review for the New Lyme Landfill site in New Lyme, Ashtabula County, Ohio. The agencies are conducting this status review of the New Lyme Landfill Superfund Site. The Superfund law requires regular reviews of sites (at least every five years) where construction of the cleanup is complete, but hazardous waste remains managed on site. These reviews are done to ensure that the cleanup continues to protect human health and the environment.

This review will include an evaluation of background information, cleanup requirements, extent of sampling, effectiveness of the cleanup, and any anticipated future actions.

Originally, both agencies selected several cleanup actions for the site. They included: a ground water pump and treat system to contain and treat contaminated ground water, a cover over the on-site landfill, and ground-water monitoring to assist in evaluating the effectiveness of the cleanup. The agencies have made modifications to the original cleanup plan, such as the shutdown of the pump and treat system, the revision of the ground water monitoring and sampling plan, and the addition of contingency plans as part of the modified cleanup.

More recently, the potentially responsible parties have conducted quarterly ground water monitoring at the perimeter of the landfill for over a year. The analytical results of these monitoring events indicated that no hazardous substances were detected above their corresponding Maximum Contaminant Level (MCL), a maximum level allowable in public drinking water.

Enclosed is an interview questionnaire, which will be handed out to neighbors of the site. Please, answer the following questions and return it in the self-addressed, stamped envelope. Your feedback and suggestions will be carefully reviewed and will help in the five-year review process. The five-year review report will be available by Spring 2003.

If you have any questions, please feel free to contact me toll-free at (800) 686-6330, ext. 249.

Sincerely,

Andrew C. Kocher Site Coordinator

anch ? Mocha

Division of Emergency and Remedial Response

ACK/kss

enclosure

RECEIT OF DETECTION OF THE PROPERTY OF THE PRO

lower

	ctions: Please answer all the questions. You may write on the back or attach an additional if necessary. Your feedback is very appreciated. Thank You.
Name:	John Mezinger Date: 24 Oct 2002
Addres	ss: 1550 Dodgeville rd
	Jefferson, Ohio 44047
1.	What is your overall impression of the project? (general sentiment)
	Good job
2.	What effects have site operations had on the surrounding community or yourself?
	New fishing hole for fisherman
3.	Are you aware of any community concerns regarding the site or its operation and administration? If so, please give details. Afraid land values mish be
4.	Are you aware of any events, incidents, or activities at the site, such as vandalism, trespassing, or emergency responses from local authorities? If so, please give details. Believe land fill sight is used as lovers lane. lots of traffic at night
5.	Do you feel well informed about the site's activities and progress?
6.	Do you have any comments, suggestions, or recommendations regarding the project (e.g., design, management, regulatory agencies, operations, etc.)?

INTERVIEW QUESTIONNAIRE

instructions: Please answer all the questions. You may write on the back or attach an additional sheet, if necessary. Your feedback is very appreciated. Thank You.

Name:	Ray and Veva Kaderly	Date: 10/24/02
Address:	1266 Didgeville Rd.	
	Tefferson, OH 44042	

- 1. What is your overall impression of the project? (general sentiment)

 Hacktelle their livestyle.
- 2. What effects have site operations had on the surrounding community or yourself?
- 3. Are you aware of any community concerns regarding the site or its operation and administration? If so, please give details.
- 4. Are you aware of any events, incidents, or activities at the site, such as vandalism, trespassing, or emergency responses from local authorities? If so, please give details.

Do you feel well informed about the site's activities and progress?


Yes

No


5.

6. Do you have any comments, suggestions, or recommendations regarding the project (e.g., design, management, regulatory agencies, operations, etc.)?

No

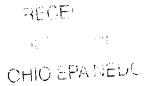

Instructions: Please answer all the questions. You may write on the back or attach an additional sheet, if necessary. Your feedback is very appreciated. Thank You.
Name: Stenement Wait Date: Det 25, 2002
Address: 1789 Lodgewille E
Address: 1789 Lodgewille E. Jefferson, Old 44047
1. What is your overall impression of the project? (general sentiment)
Well done : Onegjent
2. What effects have site operations had on the surrounding community or yourself?
none
3. Are you aware of any community concerns regarding the site or its operation and administration? If so, please give details.
Mo
4. Are you aware of any events, incidents, or activities at the site, such as vandalism, trespassing, or emergency responses from local authorities? If so, please give details.
pone
5. Do you feel well informed about the site's activities and progress?
y as
6. Do you have any comments, suggestions, or recommendations regarding the project (e.g., design, management, regulatory agencies, operations, etc.)?
Mone

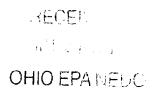

	tions: Please answer all the questions. You may write on the back or attach an additional finecessary. Your feedback is very appreciated. Thank You.
Name:	Sherry Monroe Date: 10/25/02
Addres	s: 15710 Doctgeville Pd
	Jefferson, OH 44047
1.	What is your overall impression of the project? (general sentiment) I have always felt safer knowing that the EPA is monitoring our water.
2.	What effects have site operations had on the surrounding community or yourself?
3.	Are you aware of any community concerns regarding the site or its operation and administration? If so, please give details.
4.	Are you aware of any events, incidents, or activities at the site, such as vandalism, trespassing, or emergency responses from local authorities? If so, please give details. $ \land \bigcirc$
5.	Do you feel well informed about the site's activities and progress?
6.	Do you have any comments, suggestions, or recommendations regarding the project (e.g., design, management, regulatory agencies, operations, etc.)? \uppha

Instructions: Please answer all the questions.	You may write on the back or attach an additional
sheet, if necessary. Your feedback is very appr	eciated. Thank You.

Na	me: <u>Ren Davis - (44685-4776</u> Date: <u>1/7/03</u> de: Aren Manager - ODNR
Tit	le: Aren Managa -ODNR
Ad	dress: Mosquil Creek Wildlife Aven
	Trombell Con Ohio
1.	What is your overall impression of the project? (general sentiment)
	Great deal for wildlift division, wage want up forwildlife area.
	Very pative, well maintained landfill
2.	What effects have site operations had on the surrounding community or yourself?
	turned pegatine in to portine
	incrase People - Victors - bird nothers
3.	Are you aware of any community concerns regarding the site or its operation and administration? If so, please give details.
	No (Part commany of moth level increek)
4.	Are you aware of any events, incidents, or activities at the site, such as vandalism, trespassing, or emergency responses from local authorities? If so, please give details.
	No (trash is normal for wildlife area)
5.	Do you feel well informed about the site's activities and progress?
	Not lately, but before Antdown we well informed
6.	Do you have any comments, suggestions, or recommendations regarding the project (e.g., design, management, regulatory agencies, operations, etc.)? $\mathcal{N}_{\mathcal{I}}$
7.	Do you have any concerns pertaining to the bridite area? Is the newer committee pond and wildlike area adapting with the surveyeding environment?
	Creat enbancement, adaptalia is great

Attachment B

List of ARARs

ARARs Identified for the Five-Year Review

The following ARARs are identified for the five-year review:

• Ohio Revised (ORC) Chapter 6111 Water Pollution Control

Section 6111.04 prohibits pollution to waters (including ground water) of the State of Ohio;

Section 6111.04.2 requires compliance with National Effluent Standards; Section 6111.04.3 requires permits for the discharge of wastes into well; Section 6111.07 prohibits violations of any rule or permit in regards to water pollution.

ORC Chapter 3734 Solid and Hazardous Waste

Section 3734.02(H) prohibits digging, etc., into or on any land where a hazardous or solid waste facility is located without prior authorization of the Director of Ohio EPA:

Section 3734.11 prohibits anyone from violating any section of this chapter or any rule associated with Section.

• ORC Chapter 3767 Nuisances

Section 3767.13, Section 3767.14, Section 3767.17, Section 3767.18, and Section 3767.32 prohibit nuisances regarding wells, refuse, and waters.

Ohio Administrative Code (OAC) 3745-27-13

This rule provides the means to grant authorization to engage in obtrusive actions in land where a hazardous or solid waste facility was operated.

• OAC 3745-9-10 Abandonment of Test Holes and Wells

All wells not in use must be properly abandoned.

• OAC 3745-27-14, Post-Closure Care of Sanitary Landfill Facilities

This rule specifies the requirements to continue management of leachate, landfill gas and surface water runoff. It also requires maintenance of the cap and continued ground water monitoring.

• OAC 3745-66-18 (G), Post Closure Plan, Amendment of Plan

This is a hazardous waste rule that specifies when and how post-closure care requirements can be modified. For example, it discusses how a post-closure care requirement can be discontinued upon a demonstration that it is no longer necessary. While the rule is intended for hazardous waste units, it is relevant and appropriate for other landfills as well.

Attachment C

PRP Five-Year Review Report (not received as of February 5, 2003)

The report was not received within adequate time to be included as an attachment.			***************************************	
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.				
The report was not received within adequate time to be included as an attachment.				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.				
The report was not received within adequate time to be included as an attachment.				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.				
The report was not received within adequate time to be included as an attachment.*				
The report was not received within adequate time to be included as an attachment.	tTb		within adequate time to be include	ad as an attachment '
	The report v	as not received	within adequate time to be module	ed as an attachment.